

Plat of Survey

Lot 1, Certified Survey Map 3382, being part of the SE 1/4 of the fractional NW 1/4, Section 5, T19N, R16E, Town of Vinland, Winnebago County, Wisconsin

SW Corner
Section 32-20-16
County monument

N89°19'38"E 2542.34'


North line, frac. NW 1/4, Section 5-19-16

1222.99'

1319.35'

North 1/4 Corner
Section 5-19-16
County monument

I, David Hebert, RLS, do hereby certify that this plat of survey is a correct representation of the lands described

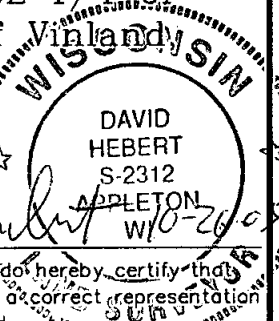

LOT 2, CSM 3382

found 3/4" iron rod bent
0.50' South and 0.50' West
of corner

found 3/4" iron rod 0.43'
South and 0.28' West of
corner

N89°41'44"E 509.60'

LOT 1, CSM 3382

intermittent
stream
aprox. wetland boundary

AREA
218235. s.f.
5.01 ac. ±



West line, East 1/2, fractional NW 1/4, Section 5-19-16

FAHLEY ROAD S 01°13'02" E 1879.00'

N01°13'02"W

355.58'

4'x4' wooden post located
6.7' North and 5.3' East
of corner

blacktop

conc.

0.46' West of corner
(disturbed)

found 3/4" iron rod 0.14' North
and 12.91' East of corner


N89°19'38"E 363.00'

330.00'

LEGEND

- ⊙ = Government corner
- = Set 3/4" x 18" iron rebar
Wt. = 1.502 lbs/lf
- ▲ = Set PK nail
- △ = Found PK nail
- = Found 3/4" iron rod
- = Culvert

SCALE: 1"=100'



4'x4' wooden post located
2.6' South and 15.4' East
of corner

found 3/4" iron rod bent 0.23'
South and 0.49' West of corner

S01°13'02"E 212.01'

N88°46'58"E 179.47'

N01°12'30"W 562.61'
LOT 2, CSM 3382

HAI Hebert Associates, Inc.
LAND SURVEYING • SOIL TESTING • ENGINEERING SYSTEMS
1110 W. Wisconsin Ave. 920-734-8373
Appleton, WI 54914 Fax: 920-734-3968

A SURVEY FOR:
Glenn Beske
7170 Fahley Road
Oshkosh, WI 54904

DATE: 10-10-18
DRAFTED BY: TS
SCALE: 1"=100'
DRAWING NUMBER:
05086A01