

JOB NO.....

DATE..... PAGE.....

# INDEX

desc.	page
• EXCAVATION NOTES	1-67


FIELD TIES	1-80
------------	------

JOB NO.....


DATE..... Oct. 2, 1979..... PAGE..... 1.....

S.C., L.K., R.O.  
Jim HANNA  
TODD SCHMCK

EXCAVATE FOR NE. COR. SEC. 6,  
18' ± E. OF & TRACKS; THIS COVERS  
E.R/W

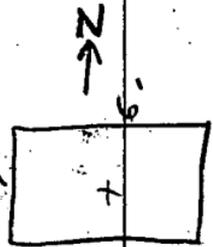

"X" & CLAIRVILLE

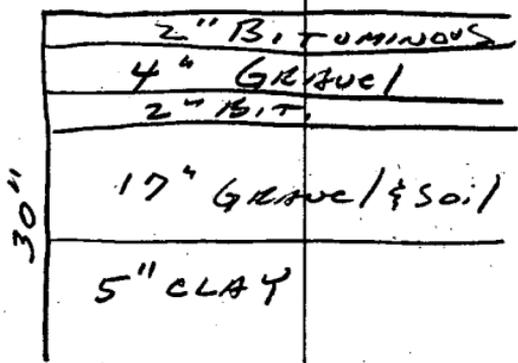

FOUND NOTHING

COR. NO. 3, IN T. 17N, R. 16E

JOB NO.....

DATE OCT. 2, 1979 PAGE 2

S.C., L.R. R.D.

Dig SECOR. SEC. 31, COR. No. 159

E Road N.

12' ± E. of  
TRACKS

↑  
6'

3" BEAR TOP

10" GRAVEL & SOIL

8" V.I.P.P.C


STOPPED EXC.

FOUND NOTHING


PARTY CHIEF.....

WEATHER.....


DIG FOR SE. COR. SEC. 31  
PROSTATE 30'E W. OF TRACK  
COR. No. 159.

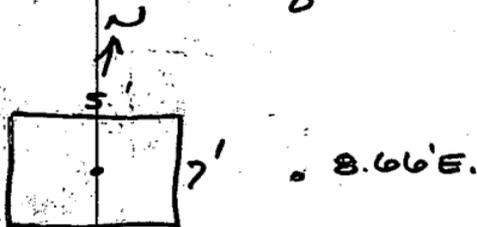

12.02'S.0

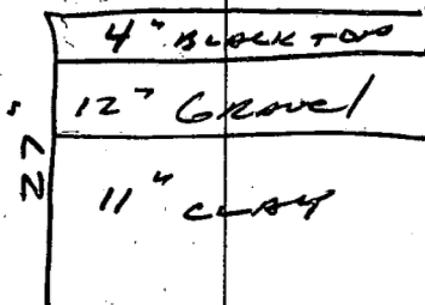


FOUND REMNANTS OF  
WOOD (CEDAR) STAKE  
& REF. BOTT. WAS JUST  
INTO CLAY

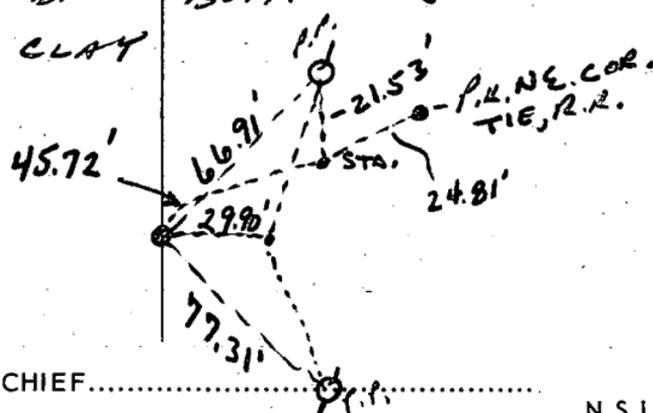

JOB NO.....

DATE... OCT. 2, 1979 ..... PAGE..... 4.....

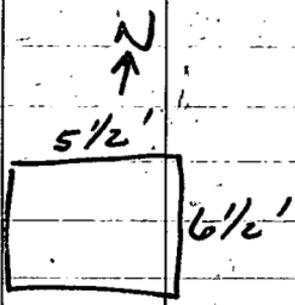

- 4" BLACKTOP
- 4" GRAVEL
- 3" BLACKTOP
- 4" GRAVEL
- 12" CLAY

FOUND NOTHING


SE. COR. SEC. 31  
 30' W. of E ROAD S.  
 Cor. No. 159

PARTY CHIEF.....

WEATHER.....

S.C., L.K., R.O.

EXC. FOR S 1/4 COR. SEC. 31  
45.87' N. P.K. in F.W.C. Post

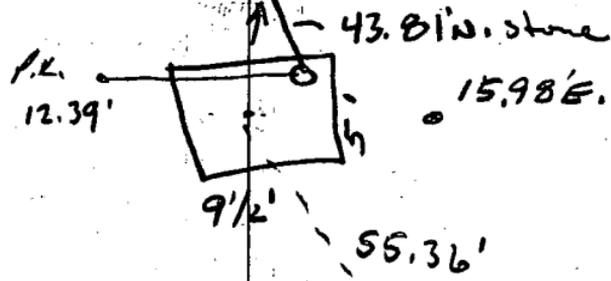

2" pipe  
with  
cap

STATE CAP  
 T. 151 N., R. 16 E.  
 SEC. 31 45' N.  
 SEC. 6  
 T. 17 N., R. 16 E.

stone down  
only stone in hole 3 to 4' E. of F.W.C.

5" BLACKTOP
12" GRAVEL
19" CLAY FILL
10" GRAVEL
6" TOP SOIL
CLAY & STONE SUBSOIL

3' total  
stone

Stone was 10" x 12" x 14"


JOB NO.....

DATE..... Oct. 2, 1979 ..... PAGE..... 6.....

S.C.L.K., RD

BXC. FOR N<sup>1</sup>/<sub>4</sub> COR. Sec. 6


T. 17N, R. 16E.

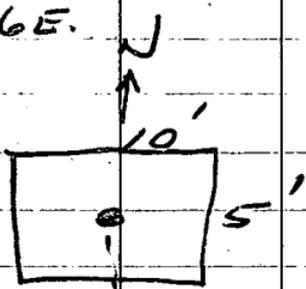

P.K.  
16.10' W.

44.95' S.  
2" pipe with  
CAP.

5'  
5'

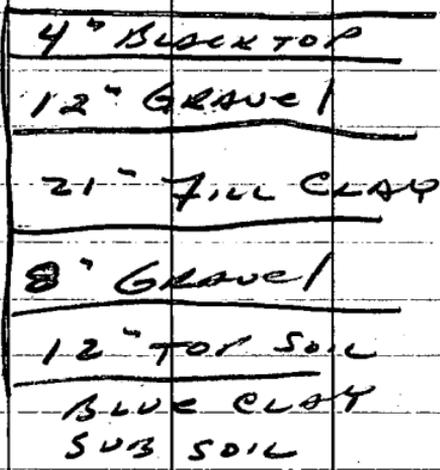

FOUND NOTHING

PARTY CHIEF.....

WEATHER.....

JOB NO.....

DATE OCT 3, 1979 PAGE 7

S.C., L.K., R.O.

P.K.  
10.32'


6 1/2'



P.K.  
11.72'E.


10'

P.K. 10.25'

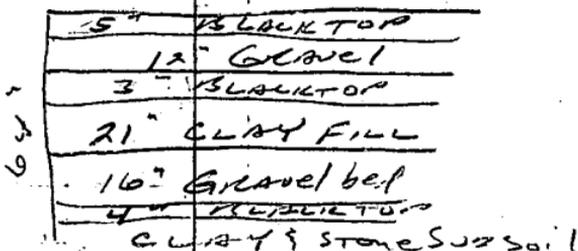

EXC. FOR 3/4 COR. SEC. 32.

COR. NO. 160 FOUND NOTHING

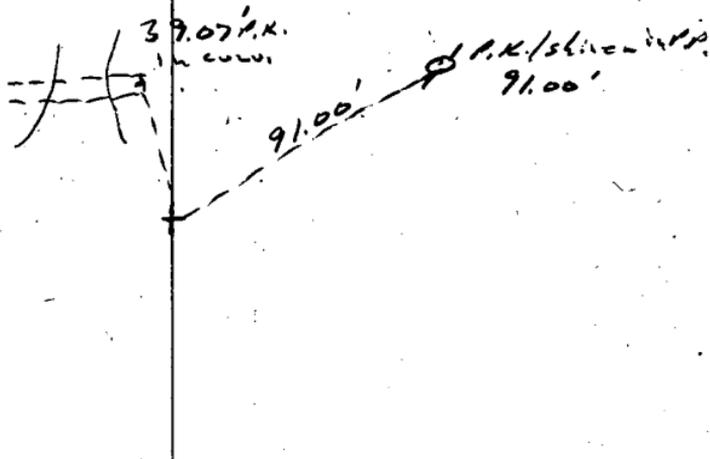


JOB NO.....

DATE OCT. 3, 1979 PAGE 8


S.C., L.K., R.D.

Exc. For S<sup>1</sup>/<sub>4</sub> cor.  
SEC. 33. Cor. No. 162

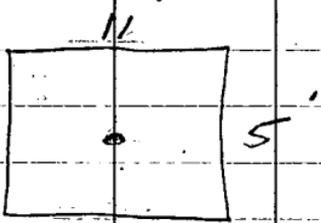

P.K.  
993°

P.K. 9.73'

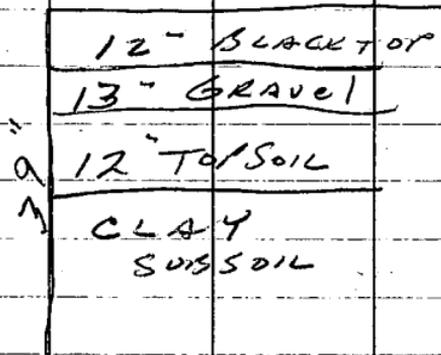

FOUND NOTHING

PARTY CHIEF.....


WEATHER.....

JOB NO.....

DATE..... OCT. 3, 1979..... PAGE..... 9.....

S.C., A.D.L.K.

E&C. FOR N. 1/4 COR. SEC. 4  
T. 17N, R. 16E. COR. No. 6

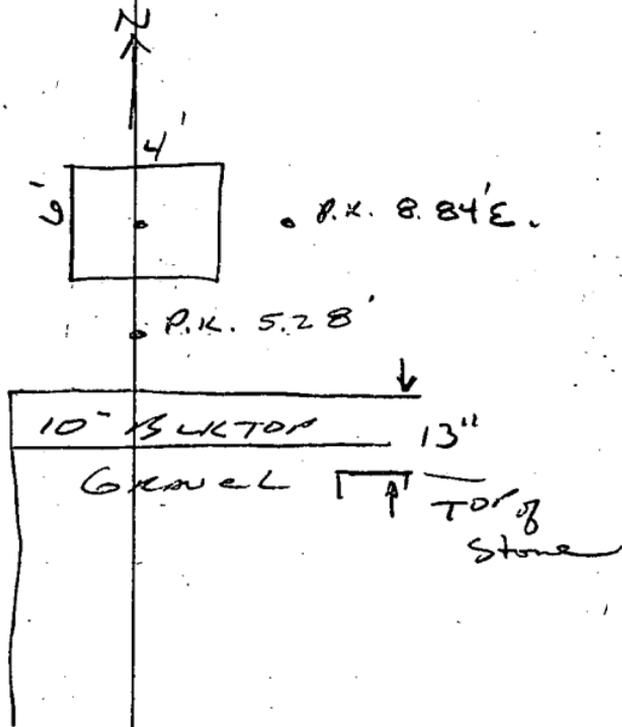

FOUND 6x6" LIMESTONE  
WITH CROSS ETCHED ON TOP

SC., R.D., 2.R.

EXC. FOR 5/4 cor.  
Sec. 34, cor. No. 164




Rod has SAMPLES  
CAR ON 2" BELOW  
SURFACE

5/8" Rod 14.26'

P.K. 14.16 N.

5/8" Rod 13.43'



P.K. 13.38 W.

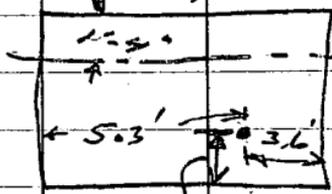

P.K. 12.27 E.

1.8'

PREVIOUS PATCH FOUND @ COR.

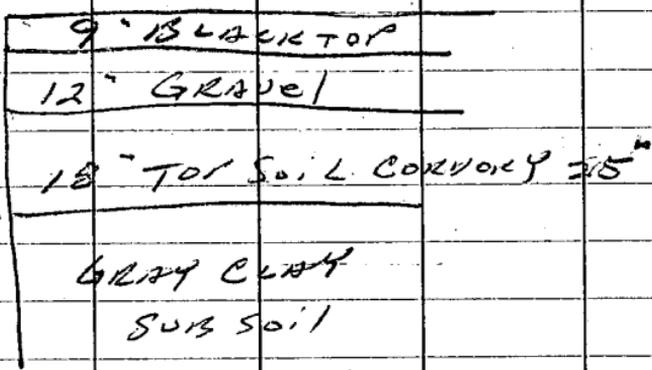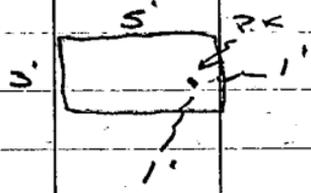

(FOUND NOTHING)  
OTHER THAN  
SAMPLER'S ROD.

PARTY CHIEF.....

WEATHER.....


JOB NO.....

DATE..... OCT. 3, 1979..... PAGE..... 11.....

S.C., L.K., R.D.

Exc. FOR E 1/4 COR.  
SEC. 31 COR. NO. 146

X  
2AC Pole  
29.15  
P.K.  
D.I.D.

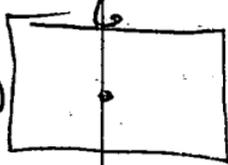

3/4  
P.K.  
D.I.D.  
29.75

P.K.  
11.95

1	2 1/2" BLACK TOP
	10" GRAVEL
30	2" BLACK TOP
	12" TOP SOIL
	CLAY & GRAVELLY SUB SOIL

ABSOLUTLY NOTHING  
FOUND

S.C., L.R.


EXC. FOR NW. COR. SEC.

31 COR. No. 131

S/S TIES N, SW, SE.  $\Delta$  S/S 32.43'

P.K.'s found 3.09 NW, 2.94 SW.

P.K. 10.0' W.

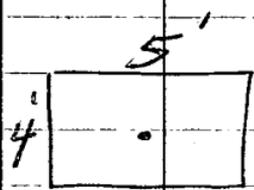


P.K. 10.80'S.

$\Delta$  S/S 38.13'

$\Delta$  S/S 37.94'

FOUND 3/8" IRON ROD 5" BELOW ROAD SURFACE P.K.'S 3.00' & 3.00' TO P.K.'S OF NATIONAL SURV.

FOUND 1" DIAM. WOOD POST REMNANTS REF. USE 2.79' NW, & 2.97' SW.

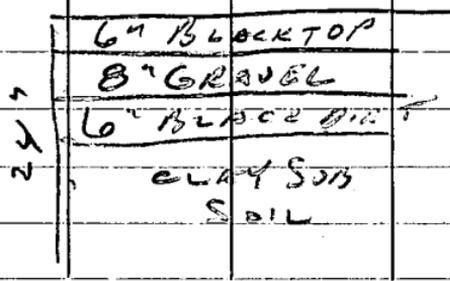




F.L.C. FOR N<sup>1</sup>/<sub>4</sub> COR  
SEC. 32 Cor. No. 134



P.K. P.P. N E 38.00'

P.K. 1052' N.

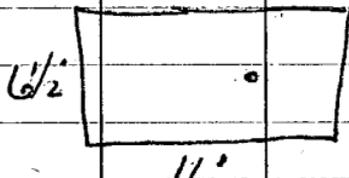

P.K. 12.14 E.

P.K. P.P. S. 32.49'

3" BLACKTOP
7" GRAVEL
10" GRAVEL $\frac{1}{2}$ IN.
6" BLACKTOP SOIL
CLOV. SUB SOIL

FOUND NOTHING

JOB NO. ....

DATE..... OCT. 4, 1979 PAGE 15

S.C., L.K.


EXC. FOR NE COR. SEC. 32

COR. NO. 135

Ø P.K. P.P. 40.52'

N

P.K. 17.66' & 2.00'

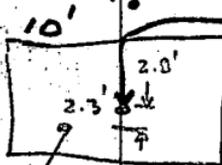

STA. 3 REBAR

P.K. 19.22'

P.K. 11.28'

Ø P.K. P.P. 50  
34.93'

FOUND 1/2" dia bar @ 17.32' S.W. P.K.

& 20.91' S. of P.K.

FOUND 3/4" IRON ROD @ ABOVE REB.

FOUND 3/4" " " @ 18.88' S.W. P.K.

16.41' OS N. I.K.

FOUND ~~15"~~ 15" REMAINS OF OLD



WOOD POST AT SOME AS 1/2" sq. REBAR

17.32' E. & 20.91' S. of P.K.'S

FOUND STONE 8" x 12" x 15" NEXT TO POST

20.46' S. of N. P.K. & 17.05' E. of W. P.K.

STONE WAS WEST SIDE KEY TO DIGGING


FOUND 4 MORE STONES ALL AROUND  
POST 2 STONES 1/2" SIZE OTHER JUST AS  
LARGE AS STONE PICTURED.

JOB NO.....

DATE..... PAGE.....

15A

NE cor. Sec. 32  
COR. NO. 135

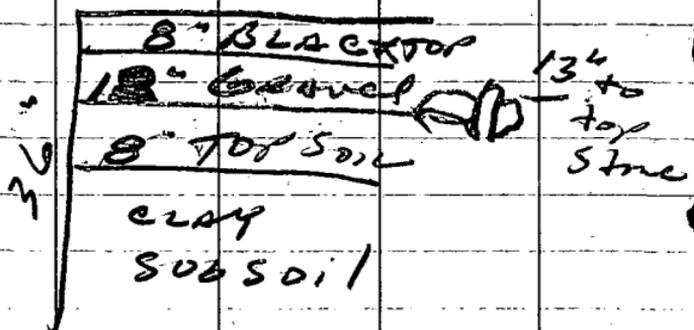

PARTY CHIEF.....

WEATHER.....

JOB NO. ....

DATE OCT. 4, 1979 PAGE 16

S.C., L.K.

Exc. NW. COR. SEC. 30,  
No. 105


P.K. 11.37 W.



P.K. 11.75 E.

P.K. 11.94 S.

Found 2" I.P. @ 11.78' W. of P.K.  
2" below surface 11.84' N. of P.K.

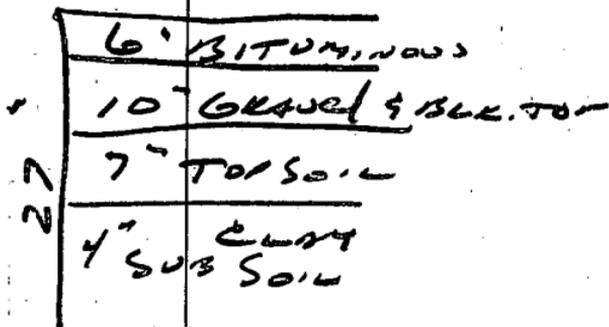

JOB NO.....

DATE.....PAGE.....

ZENTNER, JOE,  
1947 McCLOY  
OSHKOSH, WIS. 54901  
231-6339

Pete GRUBZMACHER  
544 HIGH  
Apt. 6  
OSHKOSH,  
235-7323

These men Slagged  
for us on Oct. 9, 1979  
8:00 - 4:30

PARTY CHIEF.....

WEATHER.....

JOB NO. ....

DATE Oct. 9, 1979 PAGE 17

S.C., L.K.


Exc. For. Cor. No. 139

SE cor. Sec. 27, 20<sup>th</sup> & Keweenaw


o.p.k. 24.39' / 24.63' w.o.w

N

↑ 6 1/2'

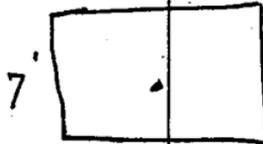

o.p.k. 17.19' / 17.01 w.o.w

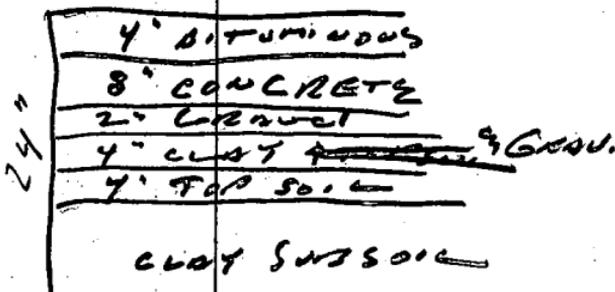

Found 1/2 brick next  
to wood remains & another  
1/4 brick, pictorial, went down  
further and for 1' still has  
post remains

JOB NO. ....


DATE Oct 9, 1979 PAGE 18

S.C., L.K.


EXC. FOR COR. NO. 138  
S 1/4 COR. SEC. 27,

N. P.K. 12.53' N.  
12.03' N. Stone

I.L.  
8.98' W.  
8.34' W.  
Stone

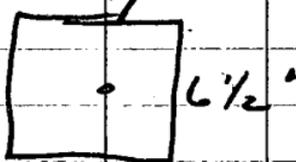

Found Stone 12" diam.  
with a depth of 12"

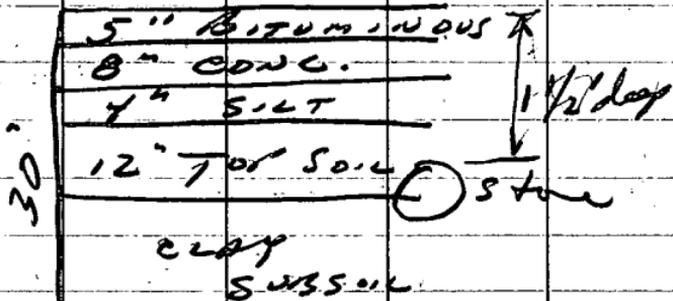

PARTY CHIEF.....

WEATHER.....

JOB NO.....

DATE Oct. 9, 1979 PAGE 19


S.C., L.C.

Etc. For Cor. No. 140

S 1/4 cor. Sec. 26


Ohio § 20th

N  
↑ P.K. 5.97' N.

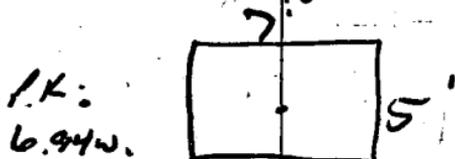

FOUND 1 1/2" sq. bolt + head in  
conc. 6.52' from W. P.K. & 6.12' from  
N. P.K.;

FOUND 6' x 6' Limestone  
under conc. 18" long  
6.19' from N. & ~~6.12'~~ 7.00' from W.

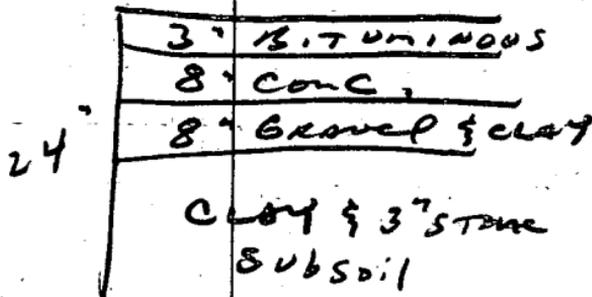


SC. L.K.

Exc. for cor. No. 166  
S 1/4 cor. SEC. 35


24.01/9.82

P.K.  
9.82' W.

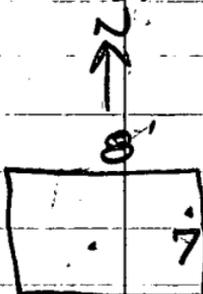

P.K.  
10.50'

8' TOP OUT OF  
H40. 24.01'

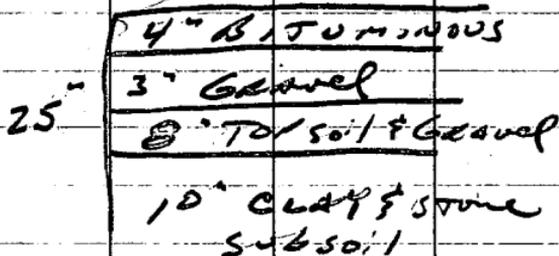

FOUND NOTHING

JOB NO.....

DATE OCT. 10, 1979 PAGE 21

S.C., L.K.

EXC. FOR COR. No. 106


NY4 COR Sec. 30

N

↑ P.K. 13.00 N.

8'

7 1/2'

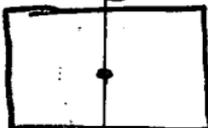

P.K. 11.535


32'

12"	BITUMINOUS
8"	GRAVEL
8"	TOP SOIL


CLAY LOAM  
SUBSOIL

FOUND NOTHING

EXC. FOR. COR. No. 107  
NE. COR. SEC. 30  
CLAIRVILLE & 9th

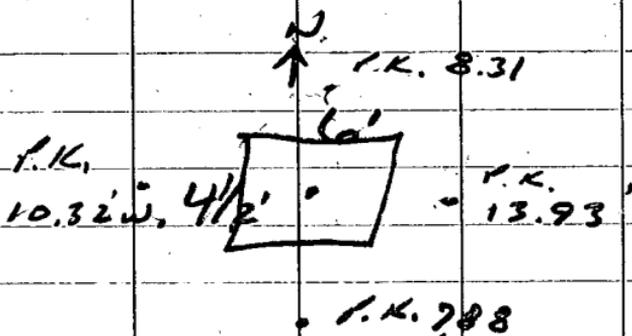


Found 5/8" rod with R.K. SATURN  
cap inside a 2" i.p., large stone  
NEXT TO pipe, dug out & below  
was wood under 2" i.p.  
See P.T. Ref.'s

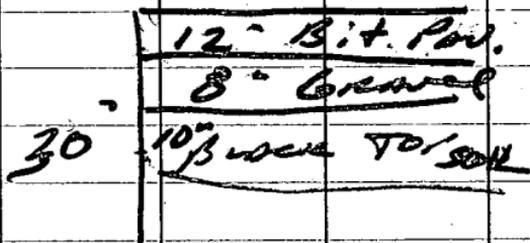


Stone & pipe was  
in Gravel Layer

Exc. For cor. No. 108  
N 1/4 cor. Sec. 29

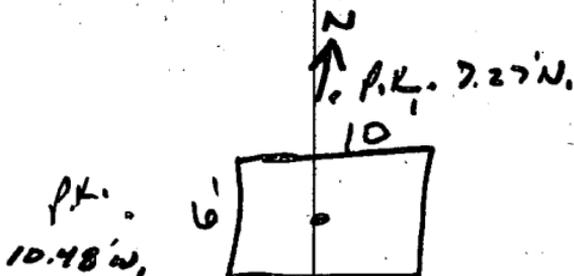

P.K. 9.18'S.

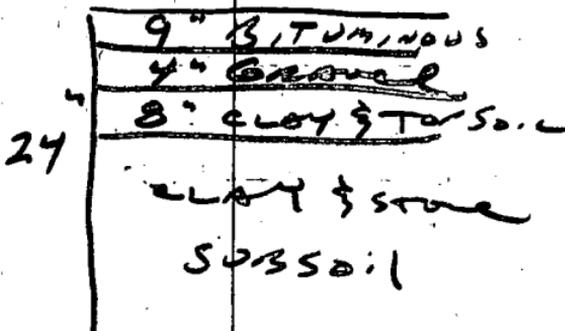

FOUND NOTHING

S.C., L.K.

EXC. FOR COR. NO. 120  
E 1/4 COR. SEC. 30



P.K.  
9.68w.



11.89s. P.K.

3" BITUMINOUS  
8" GRAVEL

32" 10" GRAVEL + OIL  
8" TOP SOIL

~~20"~~ c/w  
SUBSOIL



FOUND NOTHING

JOB NO.....

DATE Oct. 11, 1979 PAGE 25

S.C., L.I.K.

Exc. For. Cor. No. 10.9  
NE cor. Sec. 29, 9th Downway

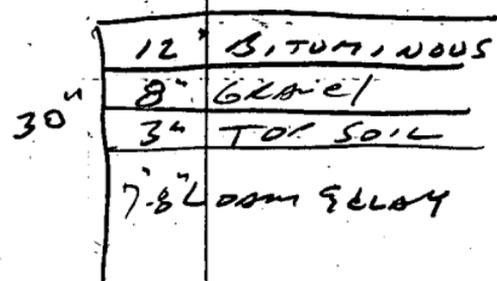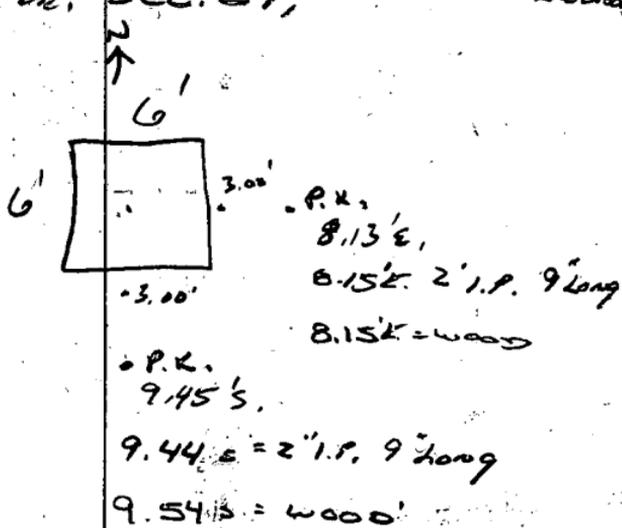

15-20" down FOUND STONES & WOOD STAKE

S.C., L.K.

Exc. FOR Cor. 110

N<sup>1</sup>/<sub>4</sub> cor. Sec. 28

↑ N

∅ 23.63 l.f.

8'



10.57' l.k.

Found P.K. under l.k. &  
P.K. spike under P.K. All  
some ties

2" l.f. @ 10.79's. & 12.53'E.

stone next to pipe

Removal and under found 6 more  
stones in @ 1 1/2' circ. seen

6" Bituminous
8" Gravel
8" Topsoil

26'

CLAY subsoil

FOUND Pipe, 8 stones & topsoil  
head


JOB NO. ....

DATE Oct. 11, 1979 PAGE 27

S.C., L.K.

Exc. For. Cor. No. 122

E 1/4. Cor. 29      OAKWOOD

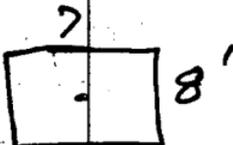

1. Kin. Col. 21.38'

21.38'

31.89' P  
P.K.P.P.

• 11.80' P.H.S.

32'

1"	BITUMINOUS
8"	GRAVEL
10"	occasional GRAVEL & TOR
13"	TOR SOIL

blue & red  
CLAY SUBSOIL


Found NOTHING

JOB NO.....

DATE..... OCT. 16, 1979..... PAGE 28.....


SC. J.L.X.

EXC. FOR COR. NO. 92  
W/4 COR. SEC. 19, T. 18N., R. 16E.

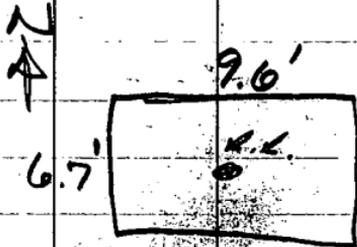

P.K. - 13.30'E.

P.K. 10.88'S.

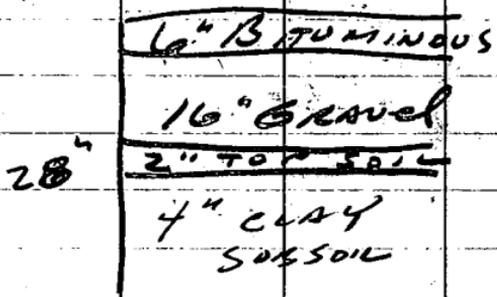

FOUND NOTHING.

PARTY CHIEF.....

WEATHER.....

EXC. FOR Col. No. 93


CENT. SEC. 19, T. 18N, R. 16E.

"L/O = 51.05"




P.K. 14.60

7'

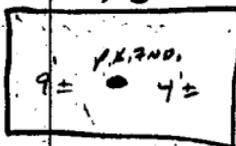

P.K. 10.85's.

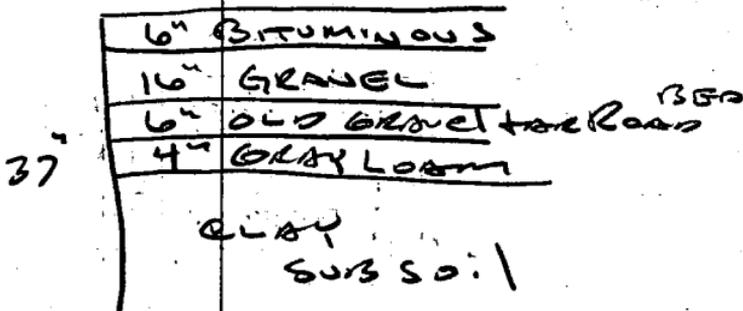

FOUND STONES & TOOK  
 PICTURE near prepared dist  
 then found numerous stones  
 6" to 18" in size all over  
 Took picture to show.  
 Guess @ 20 stones

~~NO EVIDENCE~~

S.C., L.K.


P.K.'s 10.97' N,  
9.99 W.

EXC. FOR COR. NO. 95

CENT. SEC. 20 T. 18 N., R. 16 E.

P.K. 10.97'

N  
↑

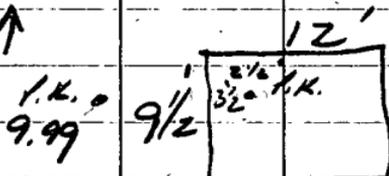

69"

5" BITUMINOUS
12" GRAVEL
22" CLAY FILL
6" GRAVEL <del>6" ROAD BED</del>
24" BLACK DIRT
BLUE CLAY SUBSOIL Then Red clay

FOUND NOTHING  
OLD EXC. 4' S. OF N. & P.K. W.  
LIMITS TO 4' E.

JOB NO. ....


DATE Oct. 17, 1979 PAGE 31

S.C., L.K.

Exc. FOR CORNER No. 96

W 1/4 cor. SEC. 21


4th & Oakway

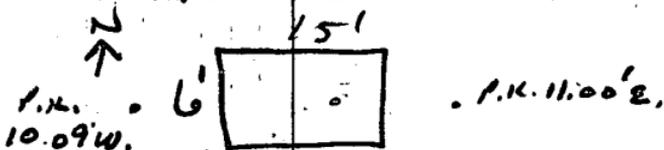

P.K. 11.32 S.

FOUND ROUND 12" STONE

REF. 11.06' W : 11.61' S.


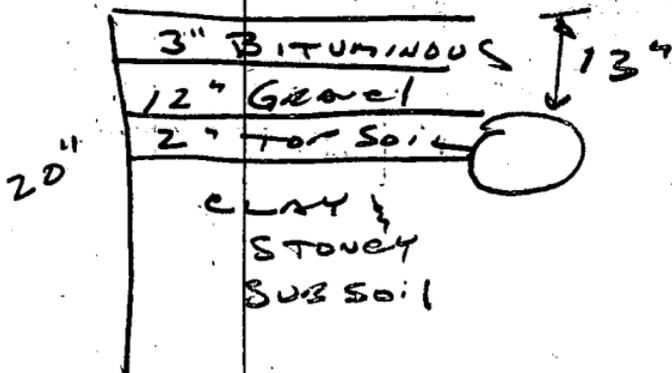


Accept stone no other evidence.

AL Schutte witnessed.

S.C., L.L.

Exc. FOR Cor. No. 97  
CENT. SEC. 2

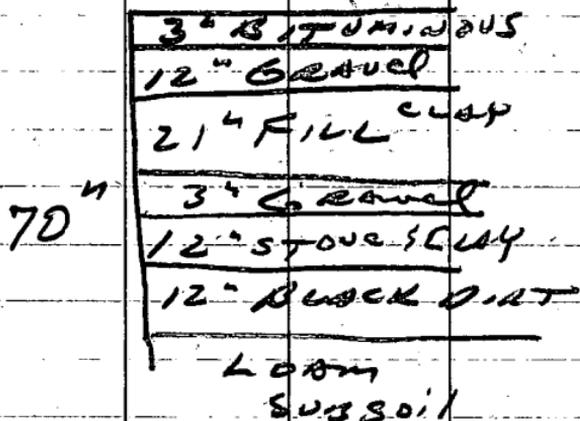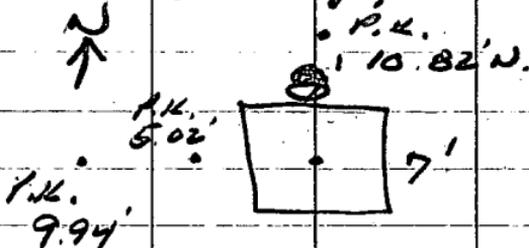


FOUND LAYER OF ROCKS  
@ 40" down

LEADS ME TO BELIEVE  
STONE WAS IN THIS LAYER  
NO ONE Exc. UNDER

S.C., L.K.

EXC. FOR COR. NO. 83  
NE COR. SEC. 20,

N  
↑

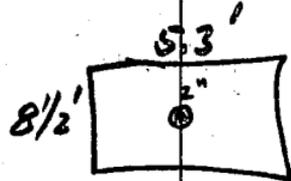

Ø 24.30'  
P.K. 14 P.P.  
Station

• 10.94'S.  
P.K.

2" PIPE IS 39" LONG.


FOUND STONE 22.56' E. & 8.31'S TO REF.

1 Seal stone  
is subsurface.  
Was found too  
deep



8" BITUMINOUS	
6" Gravel	
2" TOP SOIL	
8' CLAY & STONES	Stone in this layer
8' CLAY	

Accy + pipe, testimony of property owner to NE, stated that pipe had been in since 1919, peculiar however that pipe was right @ surface, possible road crew took pick & brought it up to grade.


Exc. Cor. No. 55  
NE. COR. SEC. 18, T. 18N, R. 16E.



10.52'  
Stone  
row 10.47

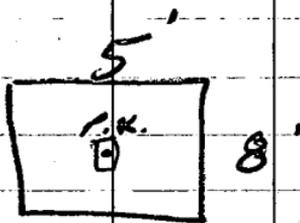

10.39 mid stone  
Stone  
10.80'

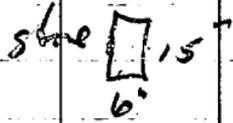


FOUND STONE



STONE WAS LAYING  
ON END, WE  
DUG OUT & UNCOVERED  
LINED TIES ARE

WHERE BOTTOM OF STONE  
MIGHT HAVE BEEN DUE  
TO BLACK DIRT IN SQ. PATTERN.

24"

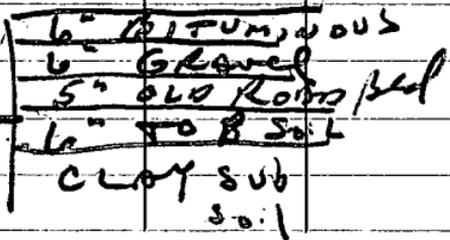

COR. No. 55 cont'd.

BECAUSE I am guessing on the position of stone standing, I realize Mr. Hyland of the State D.O.T. must have done the same so I will hold his corner position. VOID.

As ten Sinking stone  
 AT corner No. 41 feet I  
 should use center of square soiled area  
 As it must have been standing upright.  
 set corner 10.80' N.  
 & 10.47' E. of P.K.'s.



JOB NO. ....

DATE Oct. 23, 1979 PAGE 36

12:30

S.C., L.K.

E.T.C. FOR Cor. No. 40

W 1/4 COR. SEC. 7, T. 18N, R. 16E.

P.K. 12.05' N.

12.11' N. 11' W.



P.K. 10.44' W.



P.K. 11.51' E.

11.47' S. 1' W.

FOUND OLD 1" I.P. IMMEDIATELY

UNDER 8" BLACKTOP 30' LONG

FOUND ANGLE IRON @ 12.05' W. OF P.K. 9.90' S. 8' N. P.K. WITH A WOOD POST IN CENTER 1" DIAM. 3" LONG



FOUND 2 STONES 8" DIAM. 28" DOWN JUST BEFORE SUB SOIL - BROUGHT BACK TIES TO 1" I.P. & SET ON N SIDE MID STONES EAST WEST SET PLUMB BOB WHEN PIPE WOULD HAVE BEEN IN PLACE. ALSO FOUND 6" STONE NEXT TO 1" I.P. 20" BELOW SURFACE ACCEPT 1" I.P.

No. 40 cont'd

36'

8" BITUMINOUS

8" Gravel


4" Clay Fill

8" Gravel


4" Max Loam

CLAY & STONEY  
SUBSOIL

Exc. For. Corner No. 41  
CENT. SEC. 7

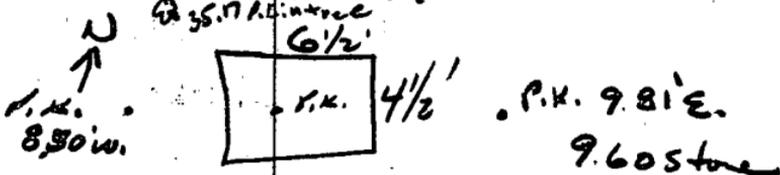

FOUND Stone 2" below  
Surface stone 12" x 12" x 20"

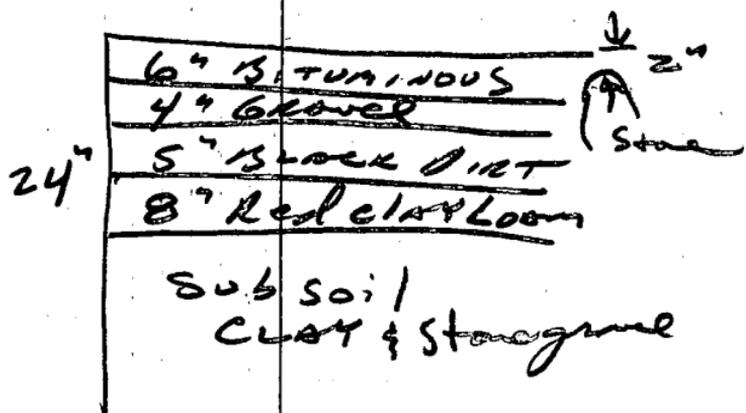



JOB NO.....

DATE OCT. 30, 1979 PAGE 40

S.C., L.K.


Exc. For. Cor.

No. 66

W. 1400. Sec. 18



13.27' P.K.

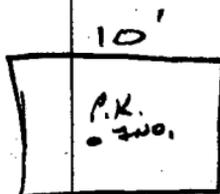

13.88' P.K.  
14.05' Post

11.22' P.K.  
12.79' Post


Found 8" long 1/2" diam. remnants of wood post 1 1/2' down, Accepted as corner dug further & found nothing. Set BEANTSEN where post was.

40"

6" BITUMINOUS
9" CONC.
6" GRAVEL
18" BLACK DIRT
BROWN SAND LOAM SUBSOIL

S.E., L.K.,

EXC. FOR CORNER No. 67; CENT. SEC. 18, T. 18N, R. 16E.

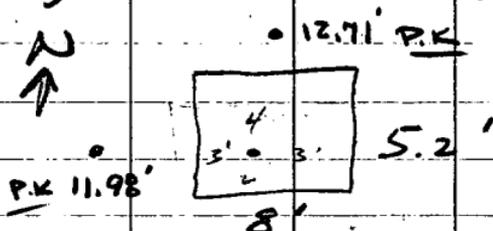

FOUND NOTHING

29'

6" BITUMINOUS
9" CONC.
4" RED CLAY FILL
4" LOAM TOP SOIL
6" CLAY SUBSOIL

SET CORNER by intersection of respective 1/4 corners.


JOB NO. ....

DATE Oct. 31, 1979 PAGE 42

SC, L.K.

Exc. FOR COR. No. 68

E 1/4 cor. Sec. 18, T. 18N, R. 16E.

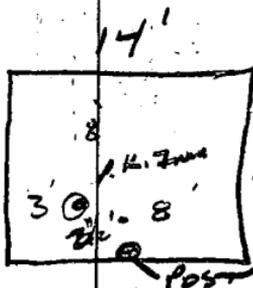


• P.K.  
11.73'  
9.29' Post

Found 2" x 15" Remnant of wood  
Post appears to have been @ 4"  
Post, bottom 5" Painted. Accepted by  
Sgt BEANTSEN.


5" Bituminous
10" CONC.
5" Gravel
12" to Soil
CLAY Stoney Subsoil

36"

Etc, FOR COR. No. 69  
CENT. SEC. 17,

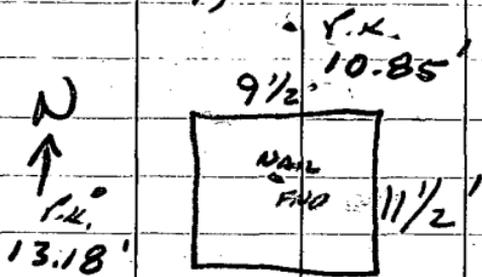

Found Nothing

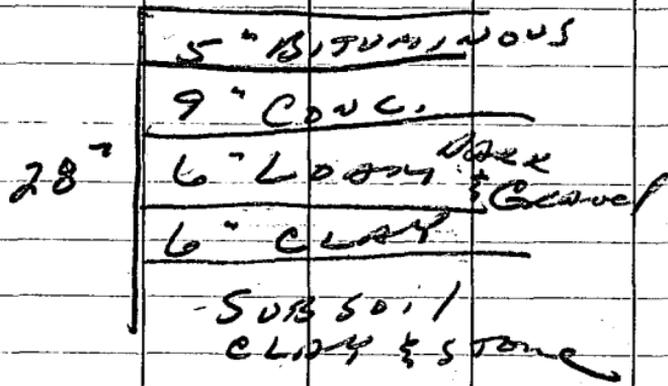


set BERNTSEN @ NAIL  
FOUND

JOB NO. ....

DATE Nov. 1, 1979 PAGE 44


S.C., L.I.C.

EXC. FOR. Cor. No. 71  
CENT. SEC. 16, T. 18 N., R. 16 E.

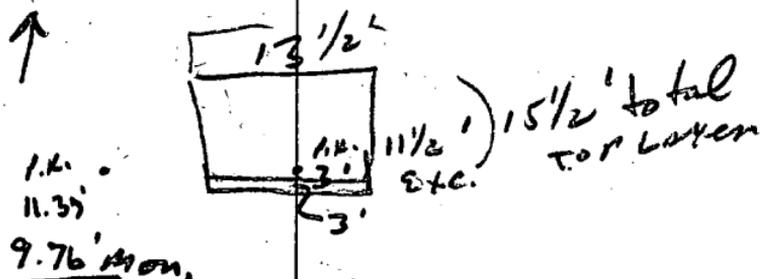

• 10.59' P.L.  
16.10' MON

DUG & FOUND NOTHING SET  
COR. FROM BEARING TREE DIST.  
59.07 + 0.75' TO FACE @ 1889 OR  
59.82' & ON STRAIGHT LINE

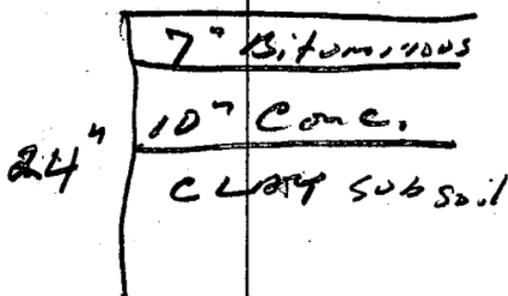

BEARING TREE STUMP OF  
OLD BR OAK NOW 48" DIAM.



JOB NO. ....

DATE Nov. 6, 1979 PAGE 46


S.C., L.K.

Exc. FOR CORNER. No. 13  
NE. COR. SEC. 1, T. 18N, R. 16E.




1/4 11.86 W.

1/4  
11.94 W.

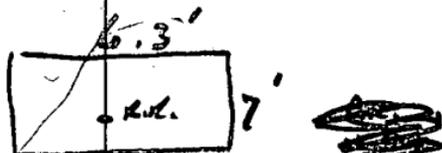

Found 1/2 piece of 6' x 8' c.T.  
Pile over flat stone, stone was  
20" x 15" x 6"; ties sit cont. of stone  
acc. to as corner, - also found  
bricks & stones around, might have  
been set by previous dig. removed  
dig & set stone back in on S. side of spot  
36" deep.

30"

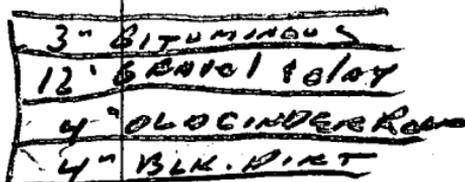


CLAY SUBSOIL


STONE in corner 15-18" deep -

Exc. For corner No. 12  
 N 1/4 cor Sec. 1 & S 1/4 cor.  
 Sec. 36, 1916

N  
 ↑

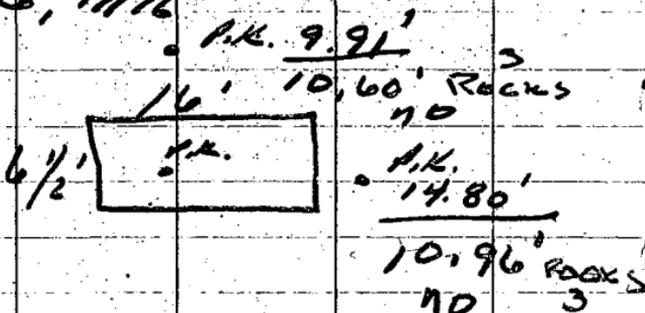

TOTAL 48"

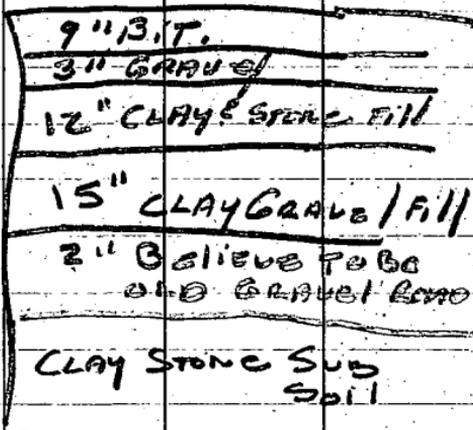

FOUND 3 STONES IN ONE AREA  
 took picture & Ref'd, then found  
 2 more near NW side hole, 1 SW  
 cor. hole then one 4' east of 1st,  
 then 2 more on E. side hole

PARTY CHIEF Forget stone S.

WEATHER.....

JOB NO. ....

DATE: Nov. 6, 1979 PAGE: 48

97th


S.C., L.

Exc. For. Cor. No. 166

S 1/4 cor. Sec. 35, T. 19N, R. 16E

N  
↑

1. K. 10.28' N 10.10' N. Stone

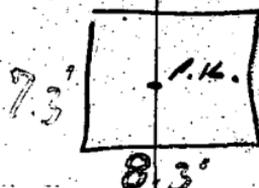


1. K. 1083' E.

10.89' E. Stone

10.27' N. to 3/4" Rod, 10.37' N. to  
 1/2" twisted Rod, 10.70' E. 1/4" Rod,  
 10.97' E. 1/2" "  
 both 4" below surface


Found Pointed Stone 10.10' S. &  
 10.89' W. of P.K.'s 12" diam. 15" Below  
 surface 17" long

Set stone back 20" below surface  
 on S. side pos. 4.00.

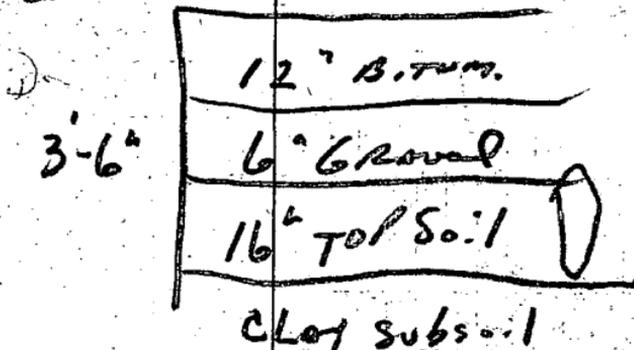


S.C., L.R.

Exc. For Cor. No. 10  
N 1/4 cor. Sec. 2, T. 18 N.

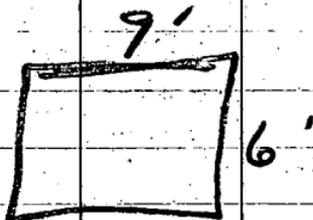

No. Rec. came 35.45'  
E. of No. 166 & 1204,  
FOUND NOTHING.

30" H

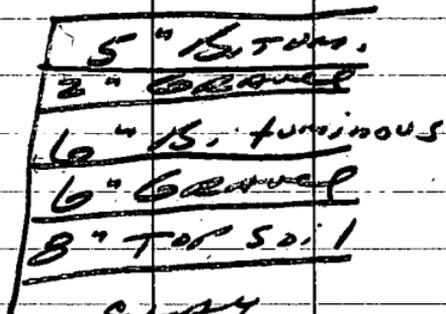

cut by  
STANWAY  
Sub So. 1


JOB NO. ....

DATE Nov. 7, 1979 PAGE 50

S.C., L.K.

Exc. for NW cor. Sec. 2


Cor. No. 9

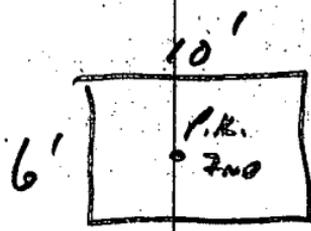

P.K.  
13.11 E.


10.64' P.K.  
S.

FOUND NOTHING, Appears to  
have been dug before

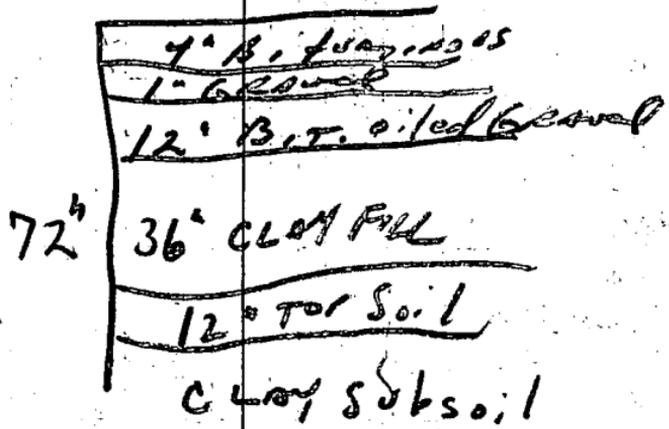

50., L.K.

Exc. Cor. No. 165  
S.W. cor. Sec. 35, T. 19/06

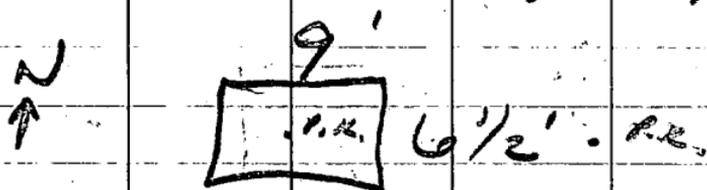

• P.K.

54"

5" BIT.
3" GRAVEL
5" BITUM.
18" CLAY FILL
12" GRAVEL
8" BLUE DIPT
BR. CLAY SUB SOIL

FOUND NOTHING  
FORGOT TO REF. put  
back by COORDINATOR

JOB NO. ....

DATE Nov. 8, 1979 PAGE 52

S.C., L.K.


E & C. For Cor. No. 8  
N 1/4 cor. Sec. 3,



P.K.

P.K.

FOUND NOTHING  
came 17 1/2' E. of cor. lot  
to dig

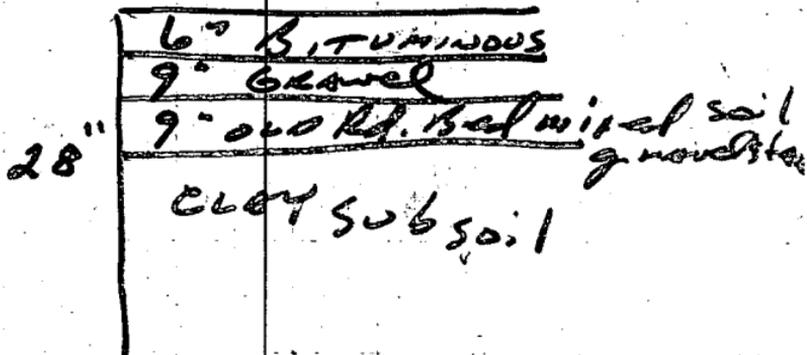

S.C.L. 721

Exc. For Corner No. 36  
S 1/4 COR. SEC. 2, 18 1/6




8.95' N.  
Stone

1. H.  
11.99' W.

8.95' W.  
Stone

R.L. G.W.

FOUND GRANITE Stone  
2.5' Feet below surface.  
Stone meas. 14" diam. left.  
In place 12" was showing


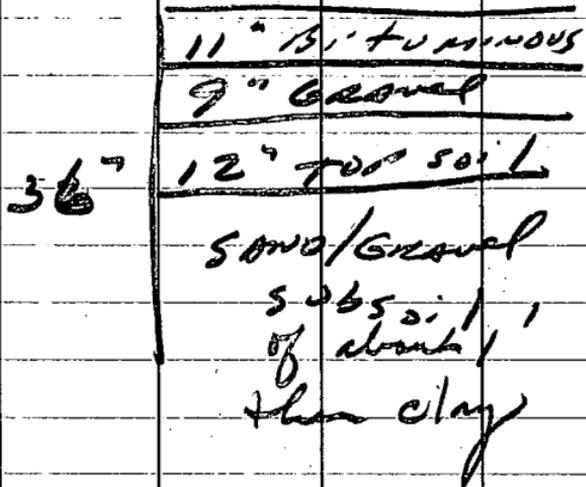


S.C., L.K.

Exc. For Cover No. 23  
CENT. SEC. 2, 18/16

P.K. 10.54 N, 10.51 N, ROD

N  
↑  
P.K.  
9.06'  
8.90'  
Rod

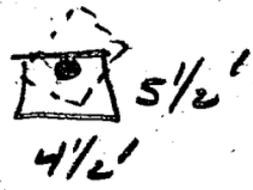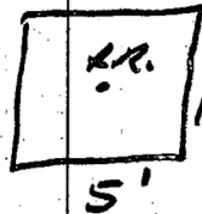


Found 3/4" x 18' IRON ROD  
2" Below surface

Nothing else in hole,  
Than N.G. Hole center of  
prorate & sound circular  
12 x 17 1/2" x 5" 17.58' E. of P.K. &  
13.99' SE. of P.K.N., removed  
& found on SW side of stone  
1/2" - 5" chain piece of old  
Yoke Link for horses.

Accepted stone & for cover.


Stone 14"  
down 25"

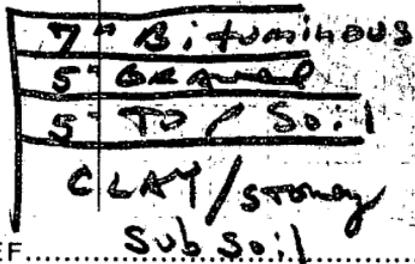




S.C.L.K

Exc. For. Cor. No. 148  
 W/4000. SEC. 33, T. 19N, R. 16E.

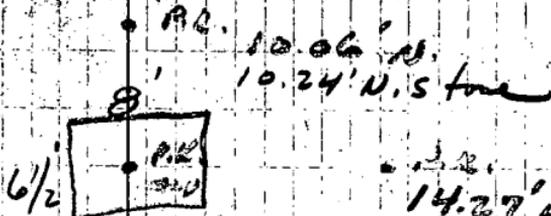

Found 5" x 7" x 13" stone  
 Approx. 15' below surface also 2  
 smaller stone approx. 8" diam. clear  
 then found post in middle  
 tie in post 10.60' N. & 16.38' E.  
 hold post.  
 Post 10" long 2" diam. with post  
 set stone on W. side, N. & SE.

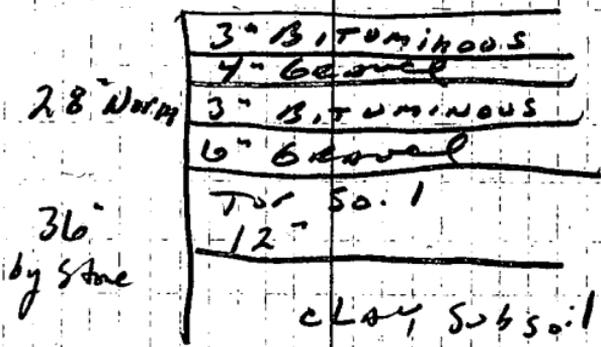



JOB NO. ....

DATE Nov. 12, 1979 PAGE 58


S.C., L.K.

EXC. FOR CORNER NO. 149  
CENTER SECTION 33, T.19N, R.16E.




CORNER WAS SET ON A STRAIGHT  
LINE AND DISTANCE WAS PROPORTIONED

FOUND ABSOLUTELY NOTHING.  
CORNER COULD HAVE BEEN  
CUT OUT. BELIEVE THIS  
WAS A CUT AREA.

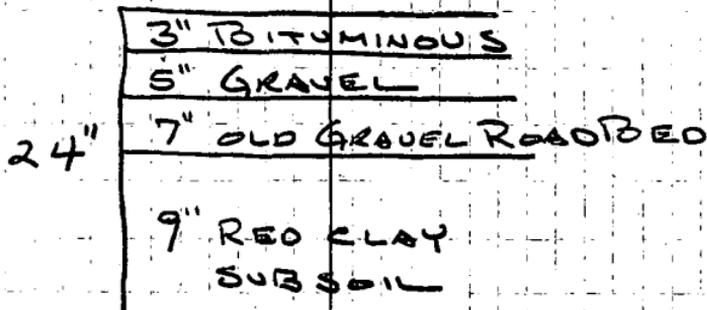




Corner No. 144 L.K. & R.D.  
 ETC. FOR W/4 COR.  
 Sec. 31, T. 18N, R. 16E.

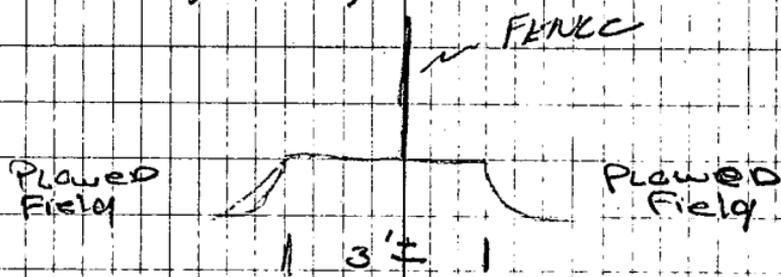

4' x 6' long

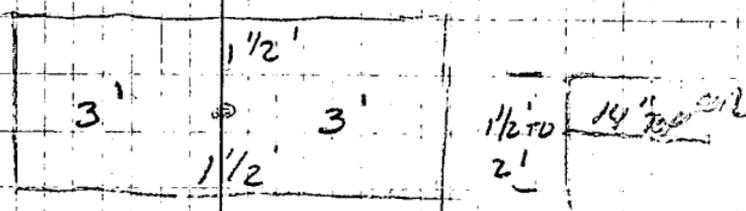


FOUND 4-6 ROCKS NO  
 EVIDENCE OF OLD POST OR WOOD  
 SET BRANTSON MAN PER  
 RECORDED POSITION AND  
 PLACED WARNING SIGN



JOB NO. ....

DATE 6/10/20 ..... PAGE 54  
L.H.  
J.H.  
R.N. 62

# EXPAND EXCAVATION 93

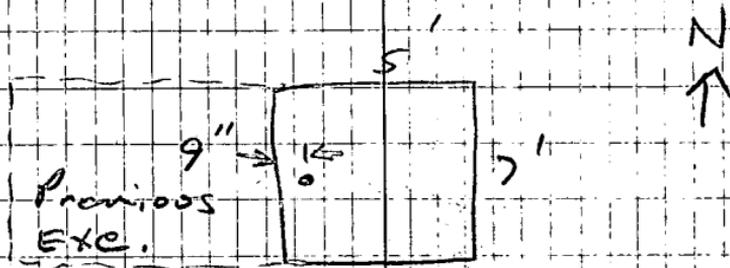

3 1/2'

5"	BLACK TOP
12"	GRAVEL
6"	asphalted Road Bed
7"	TOP SOIL / numerous stones
5"	CLAY WATER

FOUND NOTHING.





JOB NO. ....

DATE 6/10/80 PAGE R.M.

SE.  
6 1/2  
J.W. 64

Re EXCAVATE No. 8

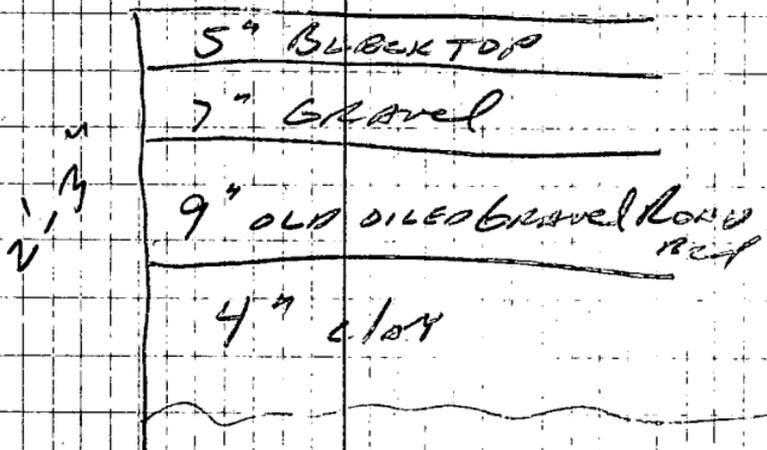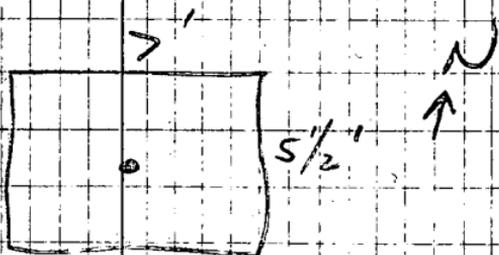

FOUND NOTHING

Centered @ 40.67' E of S. 1/4 cor.




JOB NO. .... 66 S.C. ....


DATE ..... 6/10/80 ..... PAGE ..... 616 .....

J.H.  
R.N.

Re excavate cor. No. 166  
STATE FORM ENT. @ Vinland Bend

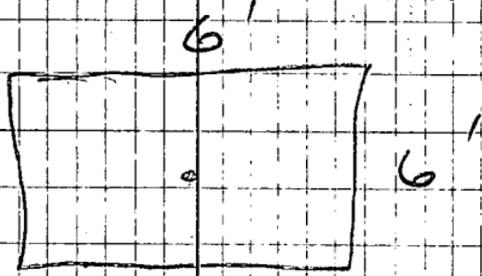

26' W. of stone found  
by stubs

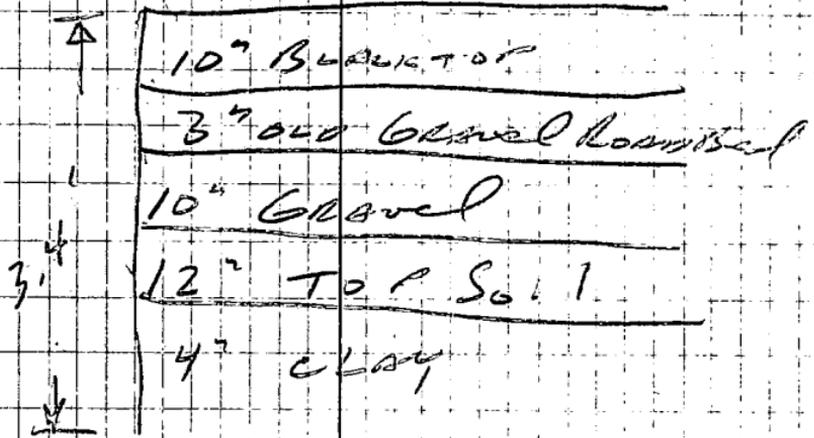

FOUND NOTHING



FIELD TIES

Page 1 to 80

See book 2

for pages 81-226





R.M. 1: 1'± SOUTH OF UNDERGROUND  
 Telephone Cable Sign 56.53'

R.M. 2: 1'± SOUTH OF UNDERGROUND  
 Telephone Cable Sign 68.65'

R.M. 3: 1'± NORTH OF yellow R/W. Post  
100.92'

R.M. 4: 20'± west of E. of Field ANT.  
56.86'

Corner No. 157

Ties To the South  $\frac{1}{4}$  CORNER Sec. 31

CORNER No. 158

REPLACE  $\frac{3}{4}$  Rod at the  $\frac{1}{4}$  WITH P.K. AND  
the ASSUMED  $\frac{1}{4}$  CORNER Sec. 31 WITH P.K.  
WITH CAP BUSTED OFF. (TRAP STATION 801)

Ref. P.K.'s

10.00' WEST

12.39' WEST

12.28 S.F.

43.81 W.W., P.K. IN  
WEST FACE OF

12" POST.

8.00' N (R.M. 3)

Existing  
Field Line

(R.M. 2)

C.T.H.

1.6'

P.K.  
P.K.

12" POST  
P.K.  
12" POST

4.5'

R.M. 4

EXISTING  
FIELD LINE

P.K.

P.K.

55.14'

11" X 11"

Q (R.M. 1)



JOB NO.....

DATE.....PAGE.....4.....

R.M. 1	1.0' ± west of Power pole	82.07'
R.M. 2	0.5' ± south of R/W. Post.	55.80'
R.M. 3	SET ON SOUTH DITCH BANK, DIRECTLY SOUTH OF MONUMENT.	45.61
R.M. 4	0.5' ± south of 12" DIA. FENCE POST.	43.27
<u>CORNER No. 158</u>		

PARTY CHIEF.....


WEATHER

**S 1/4 corner Sec. 31 T. 13 N., R. 16 E.**

**CORNER No 158**

**Larry Kriescher**  
**Nov. 14, 1979**

**Jim Cox**

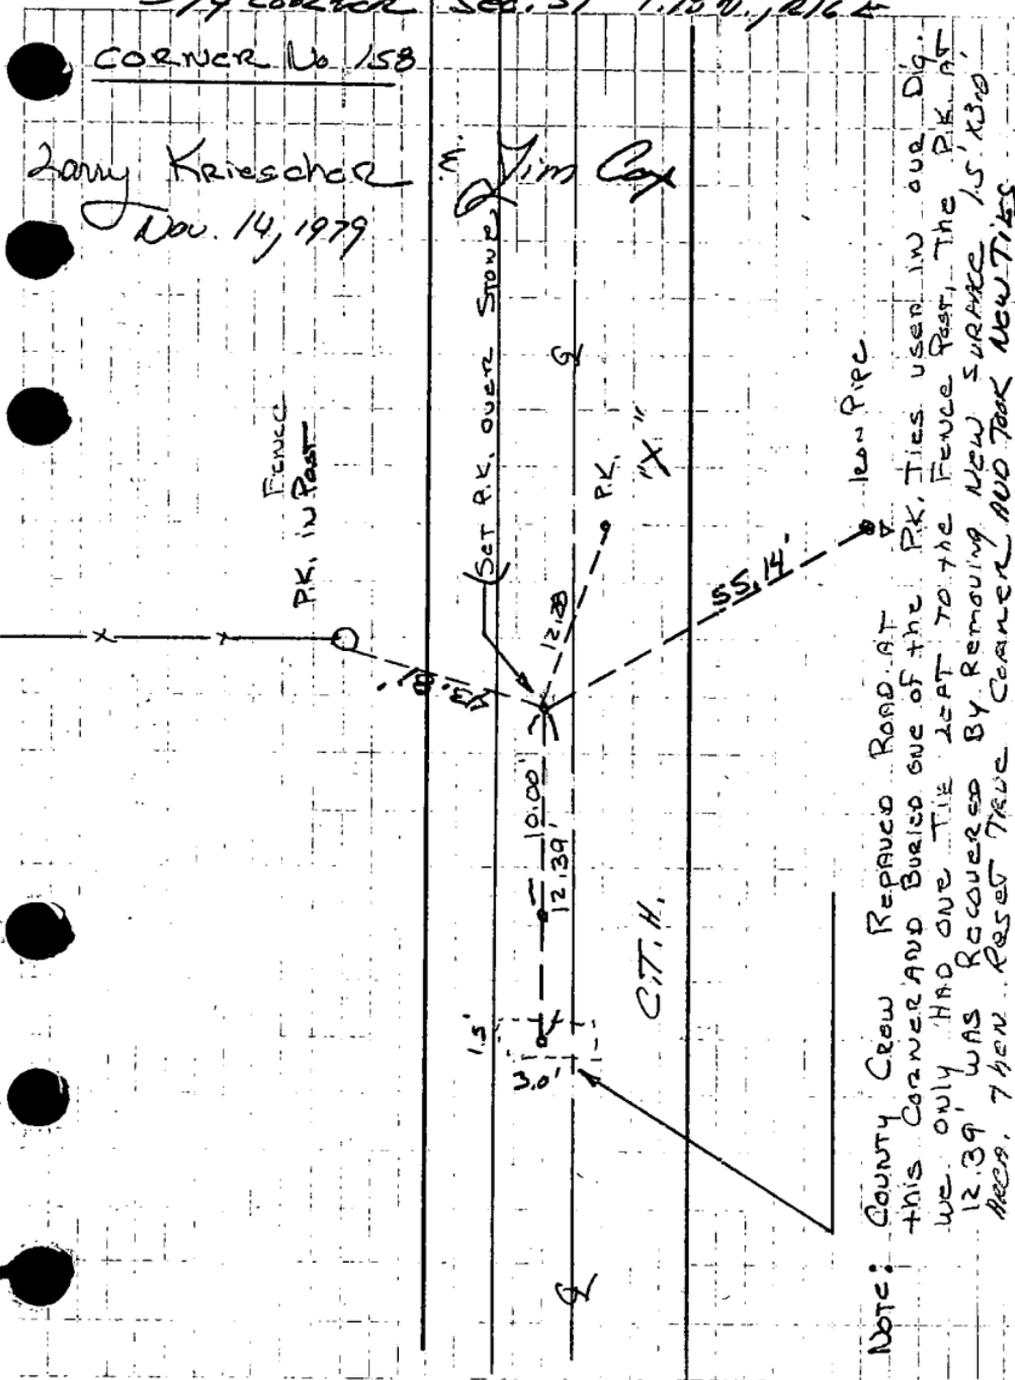

**Note:** County Crew Repaved Road at this corner and buried one of the P.K. Ties used in our Dig. We only had one tie left to the fence post, the P.K. at 12.39' was recovered by removing new surface 15' x 30' area. Then reset the corner and took new ties.



JOB NO. ....

DATE... Nov. 13, 1979 ..... PAGE 5

S.C., & L.K.


Tics To the Southeast Corner Sec. 31

Corner No 159

(TRA. STA. 800)

REF. P.K.'S 3.06 NK,

3.37 SE.

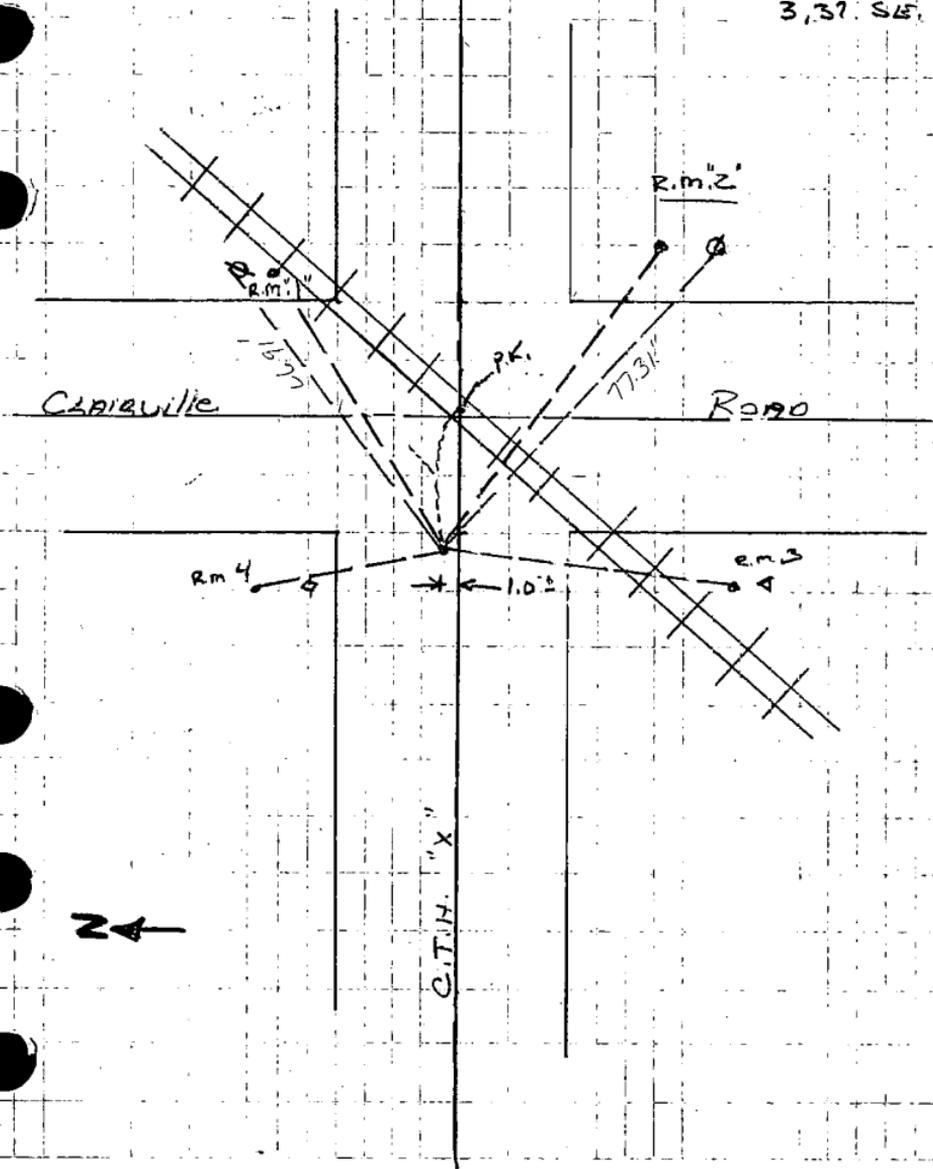

24 ←

PARTY CHIEF .....

WEATHER .....

N.S.I.

JOB NO.....

DATE.....PAGE.....6

R.M. 1	1'± SOUTH OF Powerpole			<u>65.88'</u>
R.M. 2	4'± NORTH OF Powerpole			<u>74.50'</u>
R.M. 3	1.0'± NORTH OF metal R/W Post			<u>101.60'</u>
R.M. 4	1.5'± NORTH OF 2" metal STREET sign			<u>50.20'</u>
	45.74	TRIP. STN	TO MONY	
	COR. No. 159			

PARTY CHIEF.....

WEATHER.....

JOB NO. ....

DATE Nov. 14, 1979 PAGE 7

L.K., S.C.

Ties To the S.W. CORNER SECTION 32

T.18N. R.16E, Cor. No. 161

(TRAV. STATION 34)

STAKE

TIES ALSO

Mon. is 0.5' South

of 2.

Ref. P.K.'S

10.00' NORTH

10.00' WEST

(R.M. 2)

STAKE  
TIES

DRIVE TO  
2753

DRIVE TO  
FARM

STAKE  
(R.M. 3)

STAKE  
(R.M. 4)

(~~R.M. 1~~)

R.M. 1

11

PARTY CHIEF.....

WEATHER.....

JOB NO.....

DATE.....PAGE 8.....

R.M. 2	25'± EAST OF Powerpole	<u>47.22</u>
R.M. 3	1'± WEST OF Powerpole	<u>45.08</u>
R.M. 4	1'± EAST OF ORANGE GAS VENT PIPE	<u>58.22</u>
R.M. 1	1'± SOUTH OF 3" METAL SIGN POST	<u>60.89</u>
COR. NO. 161		

PARTY CHIEF.....

WEATHER.....

EAST 1/4 CORNER NO. 150

L.K., J.C.

Sec. 33

U.S. "A4"

Ref. P.K.'S 10.00' NW,  
10.00' SW.

2333  
DRIVE

SIGN  
(R.M. 4)

(R.M. 1)

(R.M. 3)

P.K.

44.92'  
TO E. BOUND  
OF S. BOUND  
ZONE

P.K.

MON. IS 1.5'  
SOUTH E 1.0'  
EAST OF P.P.

(R.M. 2)

BIT. ROAD

N

SOUTH BOUND DRIVE (U.S. 51)

NORTH BOUND LANE



R.M. 1	2'± EAST of EAST EDGE of BIT. ROAD,	26.82'
R.M. 2	2'± EAST of EAST EDGE of BIT. ROAD,	26.63'
R.M. 3	1'± SOUTH of Powerpole	32.91'
R.M. 4	SET AT END of BIT. ROAD AT ASSUMED CENTERLINE EXTENDED	162.46
<u>Cor. No. 150</u>		

JOB NO. ....

DATE Nov. 14, 1979 PAGE 11

L.K., S.C.

TIES To the NW CORNER SECTION 31  
CORNER No. 131

NEW CORNER IS

0.15 NORTH

0.29 WEST OF

Previous TRA. STA.

PK IN NW  
FACE P.P.  
FNO.

s/s → 40

(R.M. 3)

(R.M. 2)

s/s ↗

REF. P.K.'S 2.79 NW

2.97 S.W

9.71 WEST

(R.M. 4) 10.98 SOUTH

○ CEDAR  
TRUNK  
15" DIA

s/s → 0.44 (R.M. 1)

TOP OF S/EDGE  
OF 4" F/POST

PER NAT. SURVEY  
TICS

32.29' MEAS

21 NOV  
CORNER

ST. H. "K"  
2074 580.

R.m. 1	1.0'±	SOUTH OF METAL	$\frac{5}{8}$ POST	<u>31.32'</u>
R.m. 2	1.0'±	NORTH OF METAL	$\frac{5}{8}$ POST	<u>37.45'</u>
R.m. 3	1.0'±	NORTH OF METAL	$\frac{5}{8}$ POST	<u>37.23</u>
R.m. 4	5.0'±	SOUTH OF CENTER OF CEDAR TREE		<u>51.64</u>
COR. NO. 131				

JOB NO. ....

DATE Nov. 14, 1979 PAGE 13

L.K., J.C.

TIES TO THE NE CORNER SECTION 32

T. 180, R. 16E, CORNER NO. 135


REF. P.K.'S

17.32' ~~EAST~~ <sup>WEST</sup>

20.91' NORTH

13.52' EAST

3.79' NE N.

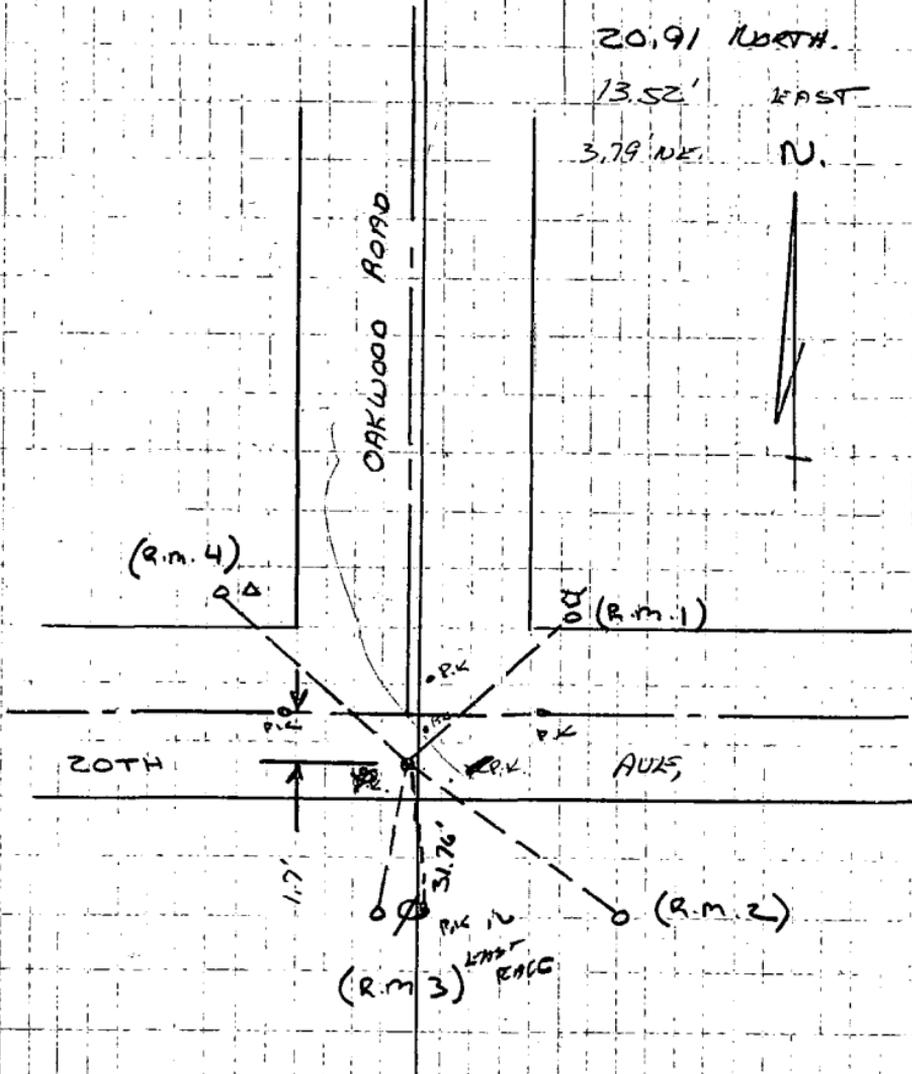

PARTY CHIEF.....


PRINTED  
IN  
CANADA

WEATHER.....

N.S.I.

R.M. 1	2'± SOUTH OF	HYDRANT	<u>56.55</u>
R.M. 2	25'± EAST OF	Powerpole	<u>39.47'</u>
R.M. 3	1'± WEST OF	Powerpole	<u>32.07'</u>
R.M. 4	1'± WEST OF	R/W. Post	<u>49.84</u>
Coc. No. 135.			

TIES TO THE W 1/4 CORNER OF  
SEC 18, CORNER No. 66

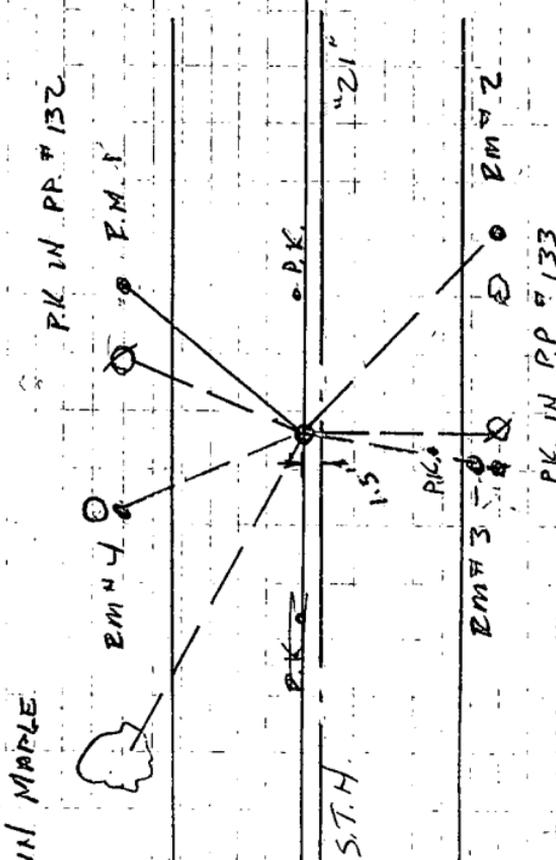

P.K. IN MAPLE

REF. P.K. EAST = 14.05  
SOUTH = 12.79  
WEST =

JOB NO.....

DATE.....PAGE 16.....

PREVIOUS READER TIES			
PK IN S. FACE	24" MAPLE	=	<u>108.34'</u>
PK IN S. FACE	P.P. # 132	=	<u>27.29</u>
PK IN W. FACE	P.P. # 133	=	<u>24.92'</u>
RM # 1	= 3' E. OF P.P. # 132	=	<u>28.40'</u>
RM # 2	= 3' E. OF SMALL COTTONWOOD TREE	=	<u>50.56'</u>
RM # 3	= 1' N. OF ONIRO RD ST. SIGN	=	<u>24.89'</u>
RM # 4	= 1' S. OF LONE FENCE POST	=	<u>35.92'</u>
CORNER #		LL	

PARTY CHIEF.....

WEATHER.....



PREVIOUS CORNER TIES S.T.C.

CENTER LEONARD RD W. SIGN = 27.97'

BACK R/W POST = 29.27'

R.M. # 1 2' S. OF 14" BOX ELDER TREE  
= 58.76

R.M. # 2 1' N. OF P.P. " = 39.75'

R.M. # 3 1" E. W. OF R/W POST = 29.08'

R.M. # 4 1' S. OF ORMOND RD. ST. SIGN.  
= 34.10'

NEW CO-ORD. W'N COR. =  
+ 0.06 IN N. E. + 0.04 IN E.


CORNER No. 40

JOB NO. ....

DATE Nov. 15, 1978 PAGE 19

L.K., R.D.

TIES TO SE CORNER SEC 7 )  
CORNER No. 55

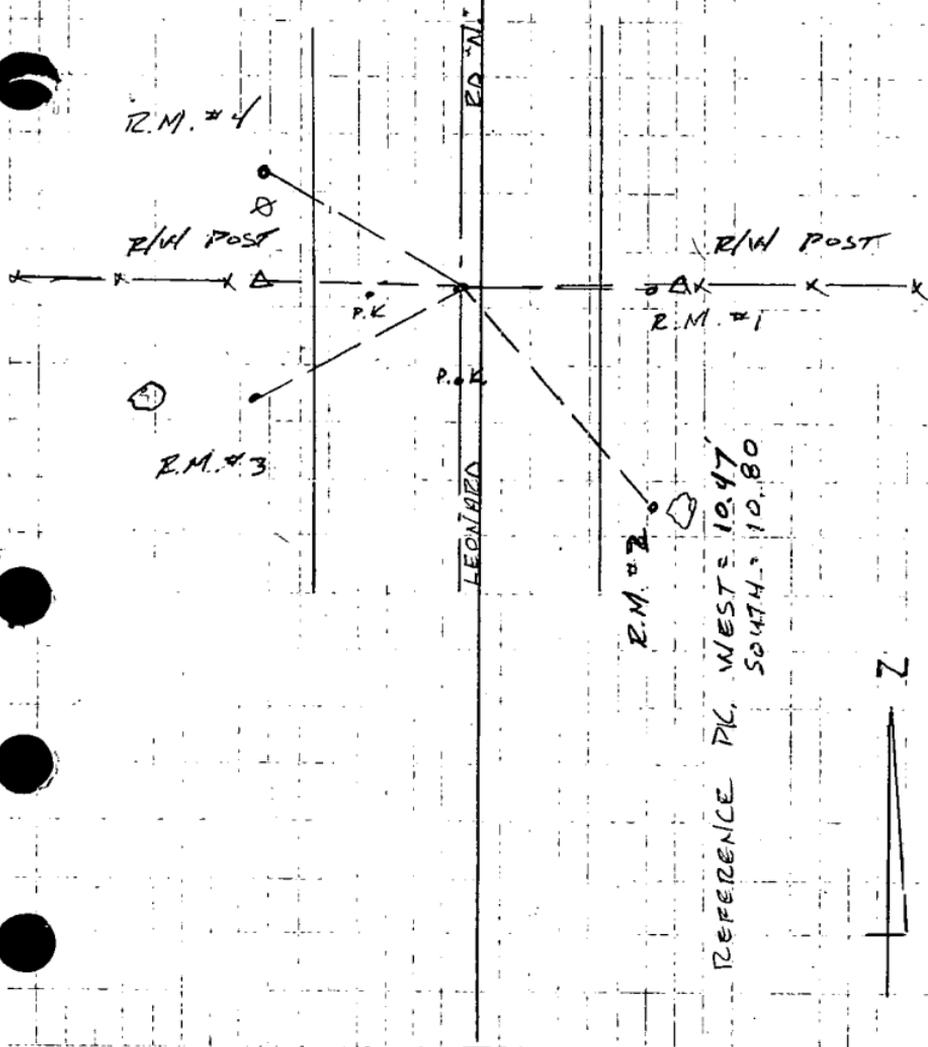

REFERENCE P.K. WEST = 10.47  
SOUTH = 10.80

PARTY CHIEF.....

WEATHER.....


CORNER No. 55R/W POST W. SIDE RD. = 32.84'R/W POST E. SIDE RD. = 33.27'R.M. #1; 1'± N. OF WOOD FENCE POST  
= 33.53'R.M. #2; 2'± W. OF PINE TREE = 71.98'R.M. #3; OPP PINE TREE = 34.14'R.M. #4; 2'± N. OF P.P. = 32.43'

END. N. PREVIOUS TIES PER SHEET.

PARTY CHIEF.....

WEATHER

CENTER SEC 18, T 18N, R. 16E,  
CORNER No. 67

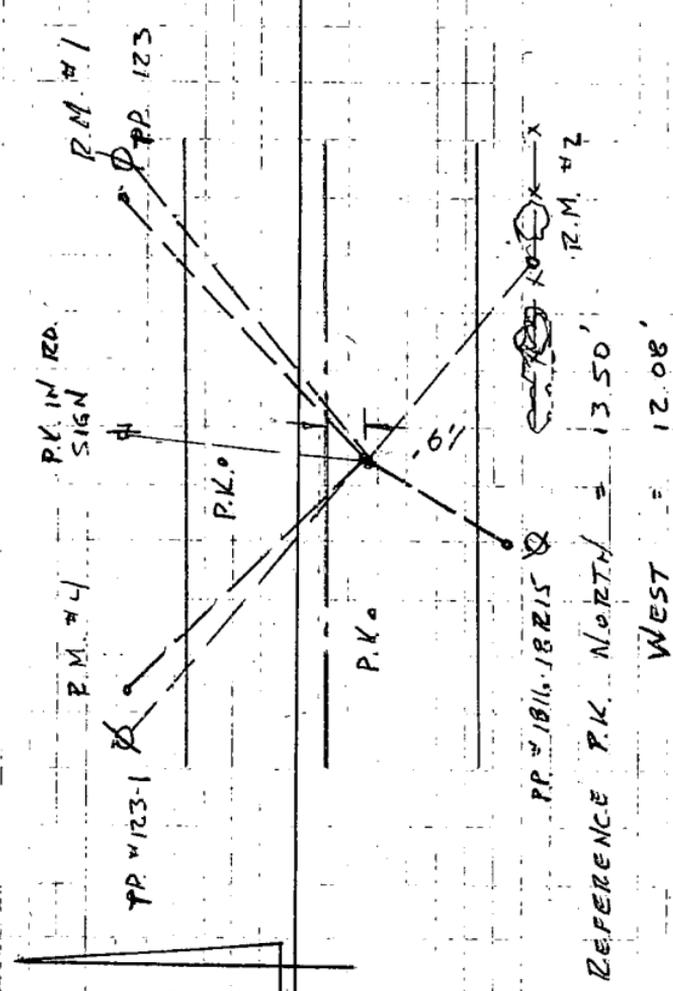

PARTY CHIEF.....

WEATHER.....

PREVIOUS	R. REIDER TIES		
P.K. NAIL IN T.P. # 123-1	=	<u>89.02'</u>	
P.K. IN ROAD SIGN	=	<u>29.47'</u>	
P.K. IN T.P. # 123	=	<u>100.10'</u>	
P.K. IN P.P. # 1816-18215	=	<u>25.82'</u>	
R.M. #1; 3'2" W. OF P.P.	=	<u>99.61'</u>	
R.M. #2; ON FENCE LINE & 3' W. OF SMALL ASH TREE	=	<u>36.26'</u>	
R.M. #3; 1'3" N. OF P.P.	=	<u>24.77'</u>	
R.M. #4; 3'1" E. OF T.P.	=	<u>84.86'</u>	
CORNER	No. 47		

PARTY CHIEF.....

WEATHER

TIES To W 1/4 CORNER SEC 33

CORNER No. 148

T. 19 N., R. 16 E.


Page 56 of Dig. Notes, Ref. P.K.'S

10.60 NORTH

16.38' EAST

10.06  
4 27'

mon. is 1.5' SOUTH  
of Assumed E

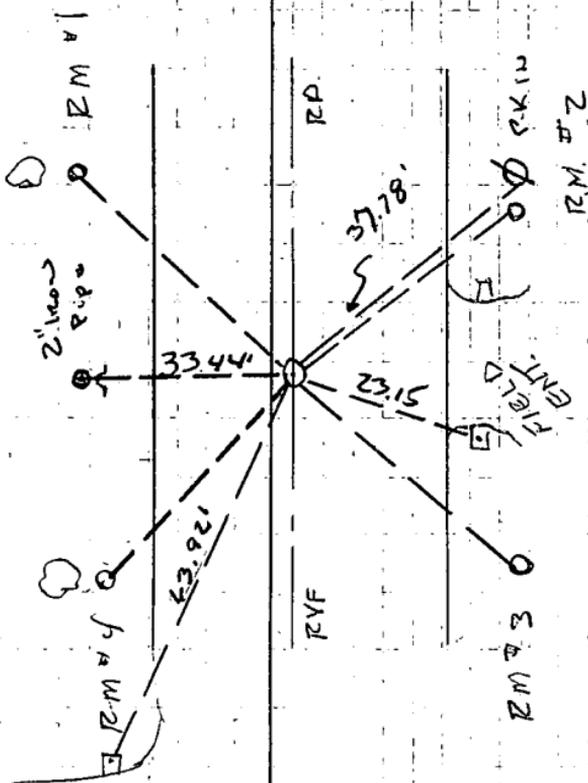

JOB NO.....

DATE.....PAGE.....24.....

CORNER No. 148

R.M. #1; 2' S. OF 8" MAPLE TREE = 48.79

R.M. #2; 1' E.W. OF P.P. #13 = 36.85'

R.M. #3; TOP OF BANK 10' E.W. OF W. END  
CULVERT = 30.57'

R.M. #4; 2' S. OF 12" DOGWOOD TREE  
= 50.89'

PARTY CHIEF.....

WEATHER.....


TIES TO CENTER OF SEC 33, T.19N,  
R.16E.; CORNER No 149.

Page 58 of Dig Notes

REF. P.R. NAILS

12.18 NORTH

16.39 EAST

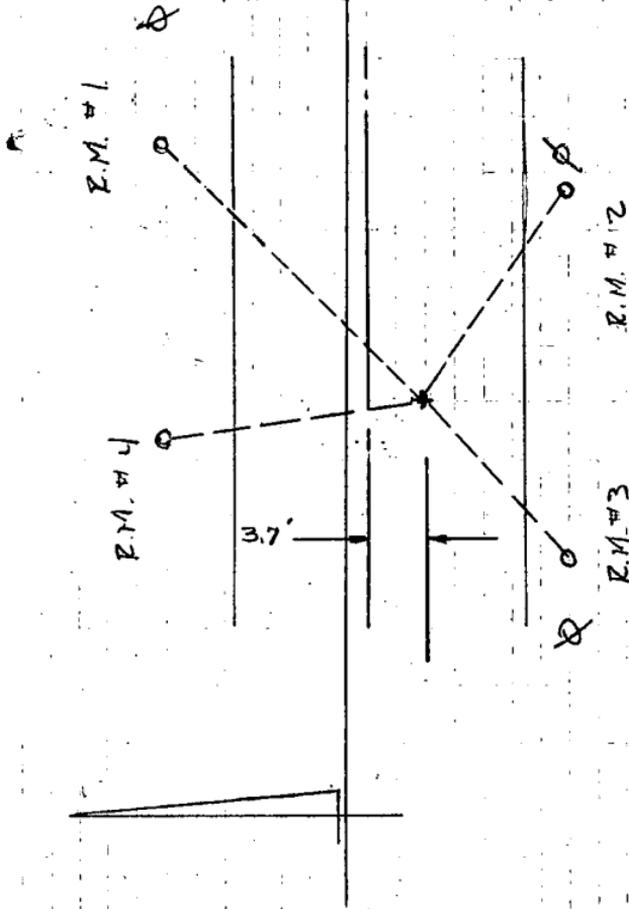

CORNER No. 149


RM. #1; 20' W. OF P.P. # 19.6-33E7  
= 109.05'RM. #2; 2' W. OF P.P. # 7 = 98.79'RM. #3; 10' E. OF P.P. # 7 1/8 = 99.18'RM. #4; TOP OF N. BANK = 48.91'

JOB NO. ....

DATE FEB. 15, 1980 PAGE 27

Tics To the SE CORNER SECTION 34,  
T. 19 N., R. 116 E. CORNER No. 165

REF. P.K. NAILS  
9.85' SOUTH  
12.11' EAST

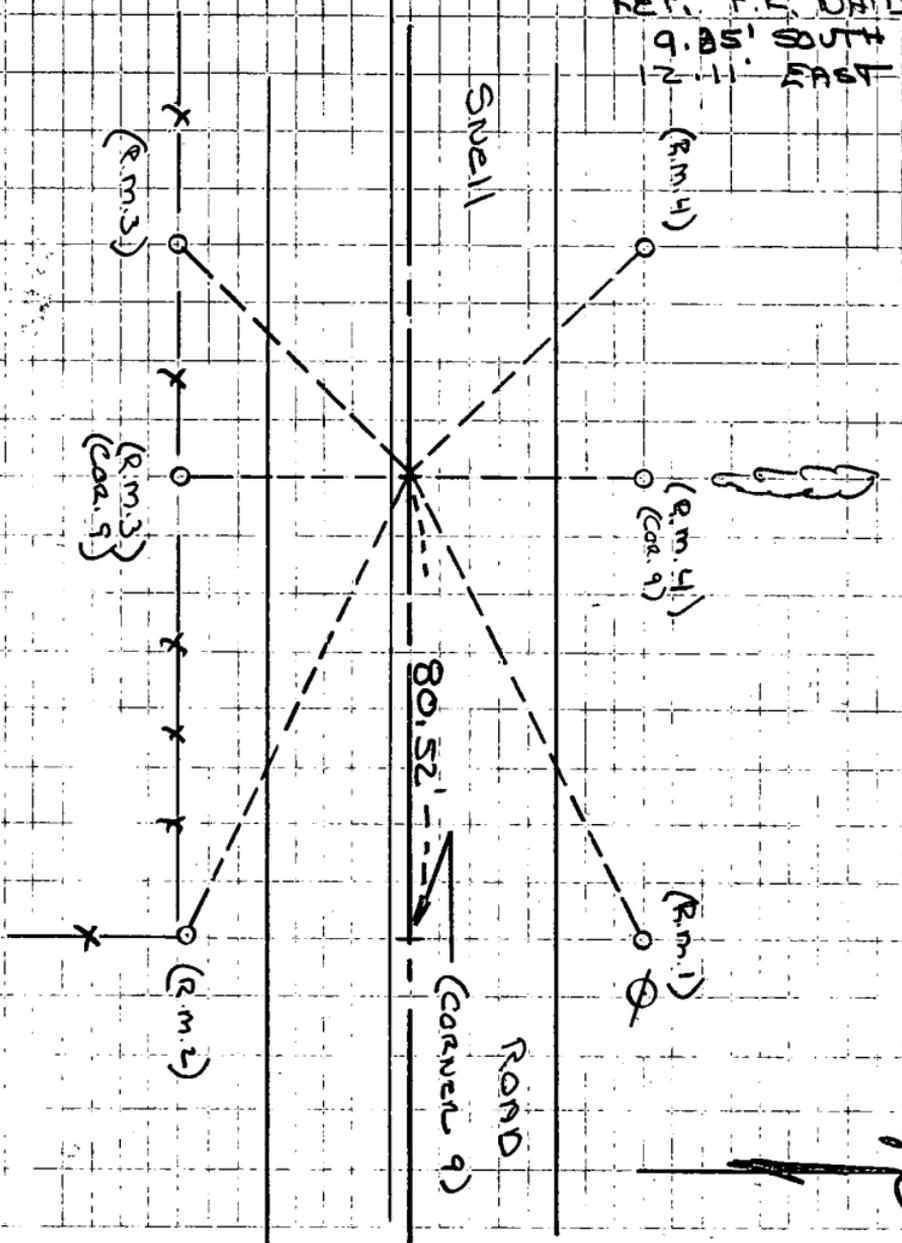

PARTY CHIEF .....

WEATHER L.K.E. R.P.

JOB NO. Corner No. 165DATE.....PAGE 28.....

R.m.1	1'± WEST of Powerpole No. 11	<u>86.25</u>
R.m.2	1'± NORTH of Fence Corner	<u>86.64</u>
R.m.3	ON Fence line 1'± EAST of Fence Post.	<u>53.36'</u>
R.m.4	ON Powerline 40'± WEST of Tree line NORTH	<u>53.97'</u>
R.m.3	of Corner No. 9, ON Fence line AT Tree line EXTENDED SOUTH	<u>32.54</u>
R.m.4	of Corner No 9 ON Powerline AT Tree line NORTH	<u>32.34</u>

PARTY CHIEF.....


WEATHER.....

JOB NO. ....

DATE FEB. 15, 1980 PAGE 89

NE. CORNER Sec. 3, T. 18N., R. 16E.  
Corner No. 9

REF. P.K. NAILS  
10.64' SOUTH  
13.11' EAST

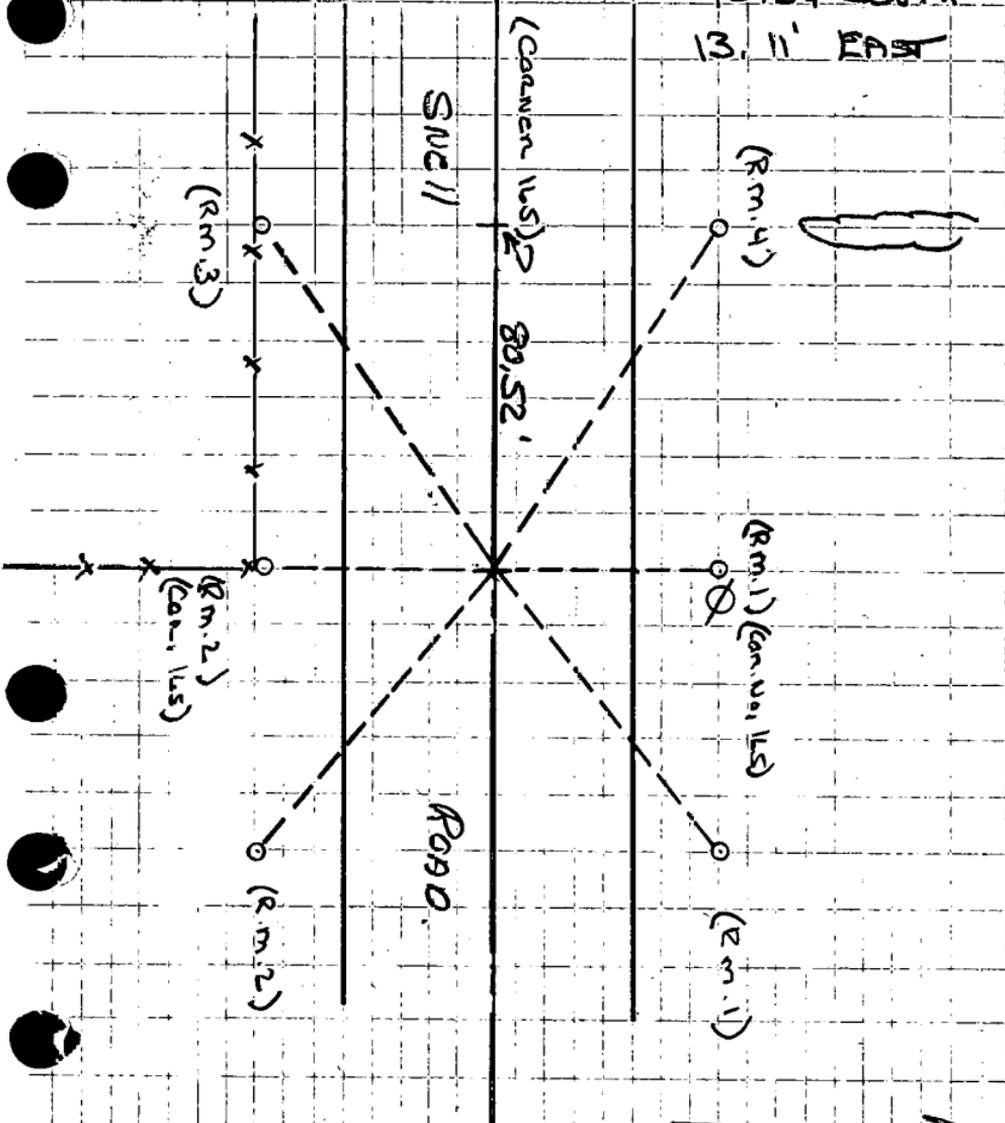

PARTY CHIEF L.K. E.P.A.

WEATHER.....

JOB NO. Corner No. 9


DATE..... PAGE 30

R.m.1	ON Powerline AND 40'± EAST of Powerpole No. 11	<u>54.10'</u>
R.m.2	ON Field Line 20'± EAST of Fence Corner.	<u>39.68'</u>
R.m.3	ON Fence line AT Tree line EXTENDED SOUTH.	<u>86.30'</u>
R.m.4	ON Powerline AT Tree line NORTH	<u>85.78</u>
R.m.1	of Corner No 165, 1'± WEST of Powerpole No. 11	<u>32.74'</u>
R.m.2	of Corner No. 165, 1'± NORTH of Fence Corner	<u>32.64</u>

PARTY CHIEF.....

WEATHER.....

TIES TO THE S 1/4 COR SEC 35, T.19N,  
R.16E ; COR. No 166  
TO THE N 1/4 COR SEC 2, T.18N,  
R.16E ; COR. No 1060 EAST.

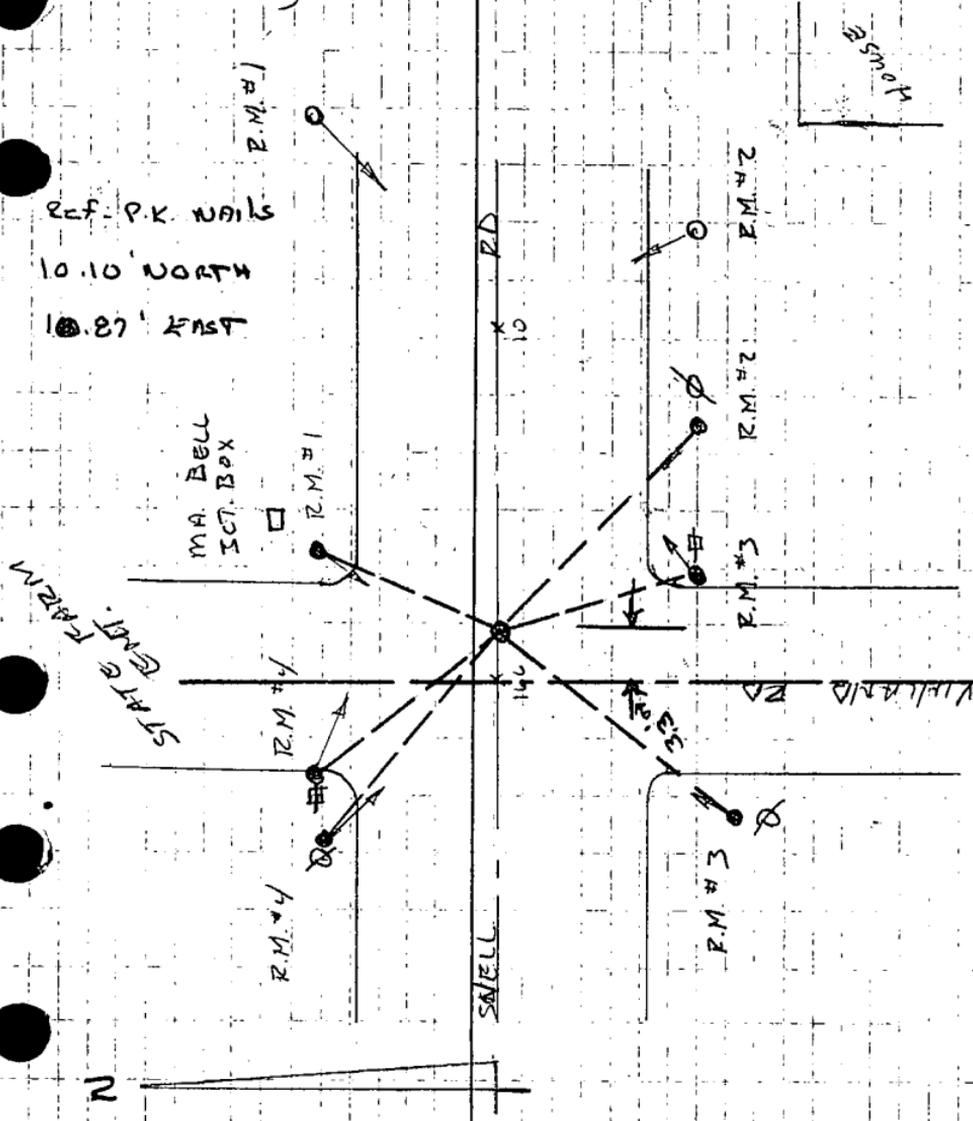

PARTY CHIEF... LARRY KRITZSCHER .....

WEATHER.....

S<sup>1</sup>/<sub>4</sub> COR. SEC. 35, COR. No. 162R.M. #1; S<sup>1</sup>/<sub>2</sub> SW OF MA. Bell Jct. Box  
= 47.01'R.M. #2; 1' S W OF ~~PP~~ L.P. = 50.98'R.M. #3; 1' N. OF P.P. # 34 = 57.60'R.M. #4; 1' E OF P.P. # 35 = 40.93'R.M. #3 OF CORNER No 10 = 27.95'R.M. #4 OF CORNER No. 10 = 37.61'

N 1/4 COR SEC 2, COR. No 10


R.M. #1; ON POWER POLE LINE @ W. FACE  
OF HOUSE SOUTH EXT. NORTH = 64.61'R.M. #2; 20' ± E OF P.P. = 41.30'R.M. #3; 17' W. OF STOP SIGN = 40.20'R.M. #4; 2' ± E. OF STATE PROP. NO  
TRESPASSING SIGN = 60.15'R.M. #1 OF CORNER No 166 = 9.29'R.M. #2 OF CORNER No 166 = 31.90'  
1.5' ± W. OF P.P.

NOTE 35.45' TO COR. No 166 WEST



TIES TO THE CENTER OF SEC 2,  
T. 18. N. 3 R. 14 E., CORNER No. 23

17.58' WEST  
13.99 NW,  
10.00 NORTH  
10.00' WEST

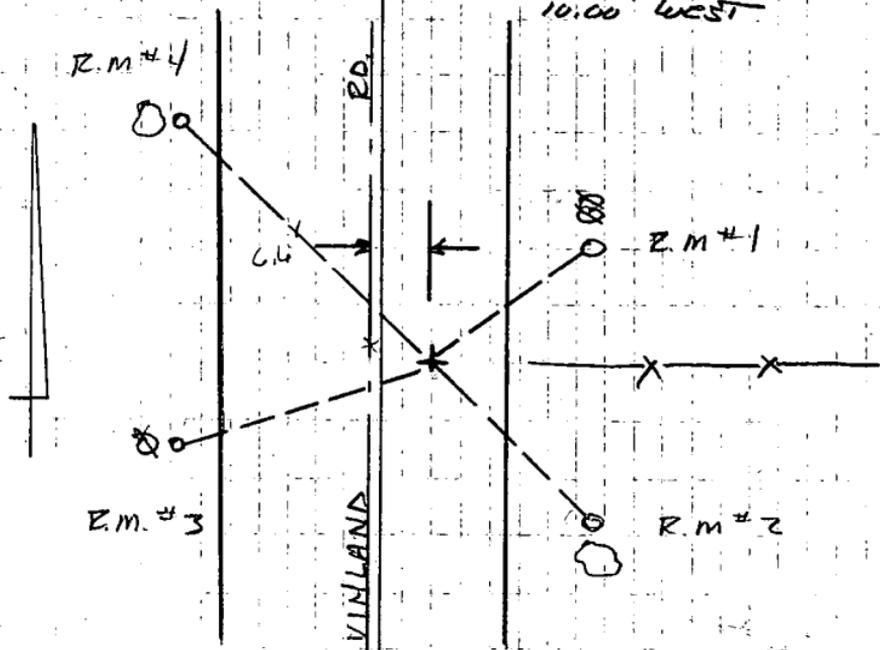

JOB NO.....

DATE.....PAGE..... 36

CORNER No. 23

R.M. #1; 2 1/2 S. OF OLDEST OF 2 P.P.'S = 51.37'

R.M. #2; 5' S. N. OF CENTER OF LILAC  
BUSH = 72.42'

R.M. #3; 1' E. OF P.P. = 36.74'


R.M. #4; 1' E. OF 2 1/2" STUMP = 81.80'

PARTY CHIEF.....

WEATHER.....

Ties To the S<sup>1</sup>/<sub>4</sub> corner Sec. 2, T. 18N R. 14E  
Corner No. 36

REF. PK NAILS  
8.95' NE  
8.95' SW

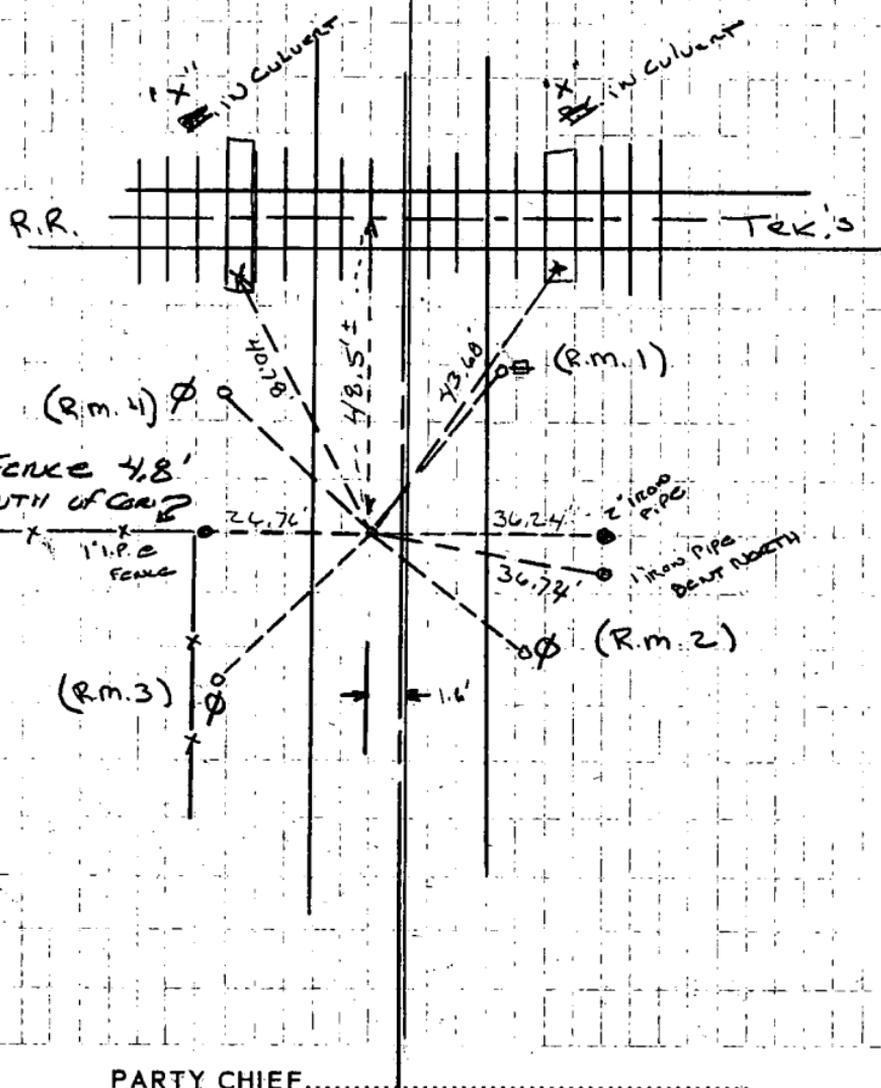

NOTE:  
Fence 4.8'  
SOUTH of CR 2  
1" P.E. FENCE

(R.m. 4)  $\phi$

(R.m. 1)

2" IRON PIPE

1" IRON PIPE  
DEPT NORTH

(R.m. 3)

$\phi$  (R.m. 2)

JOB NO.....


DATE.....PAGE 38.....

R.m. 1	1' ± WEST OF R/R <sup>CROSS</sup> SIGN	29.98'
R.m. 2	1' ± WEST OF P.P. #17	50.85'
R.m. 3	1' ± NORTH OF P.P. #59	44.52'
R.m. 4	1' ± EAST OF P.P. #21	42.70'

PARTY CHIEF.....

WEATHER.....

TIES TO SW COR SEC 36, T. 19 N,  
R. 16 E; COR. No. 167 &  
NW COR. SEC 1, T. 18 N, R. 16 E;  
COR. No. 11.

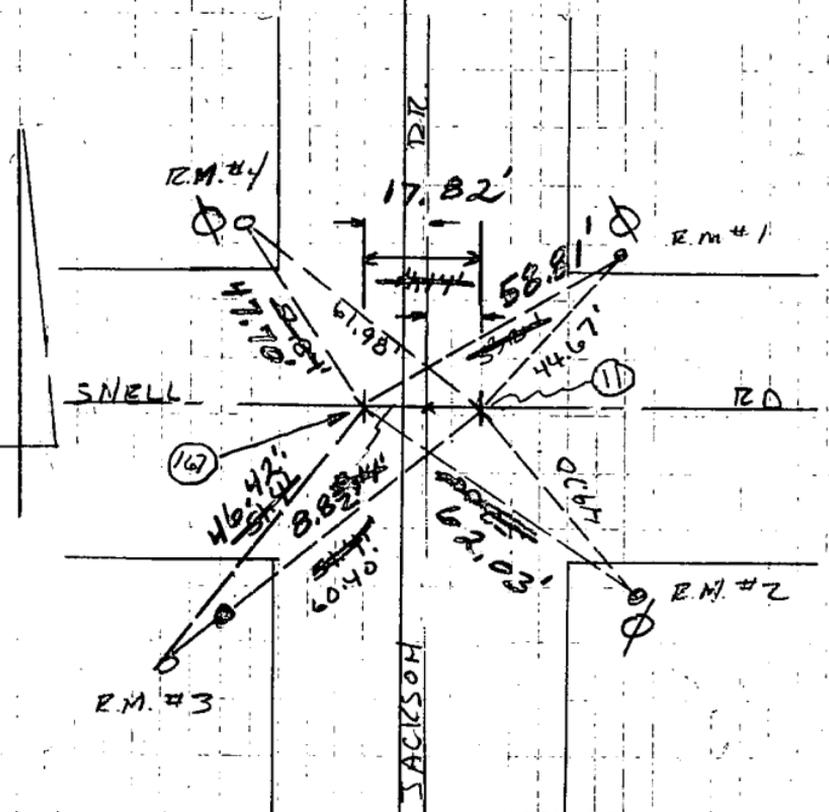

changed cor. 167 to sit on G.S. miss  
 These ties good for cor. 11  
 only st.c. 6/13/80  
 Retied 167 6/16/80 st.c., L.K.

PARTY CHIEF... LARRY KRIESCHER

JOB NO.....

DATE.....PAGE 40.....

CORNER No 107 & 11

R.M.#1; 1/2 S OF PP # 6300 13 2/8 =

R.M.#2; 1/2 N OF PP =

R.M.#3; 7/8 SW OF B/W GUARD POST

R.M.#4; 1/2 E OF P.P. #100308 =

PARTY CHIEF.....

WEATHER



JOB NO.....

DATE.....PAGE.....42.....

COR. No. 163

R.M. #1 ; 1' E. OF P.P. # 12-5 = 31.58'

R.M. #2 ; 1' N. OF WOOD FENCE POST = 59.94'

R.M. #3 ; 3' E.W. OF WOOD FENCE CORNER = 35.42'

R.M. #4 ; 1' E. OF P.P. # 12 = 69.95'

PARTY CHIEF.....


WEATHER

TIES FOR NE COR SEC 1, T. 18 N,  
R. 16 E; CORNER No. 13

REF. P.K. NAILS

11.86 NORTH

11.94 WEST

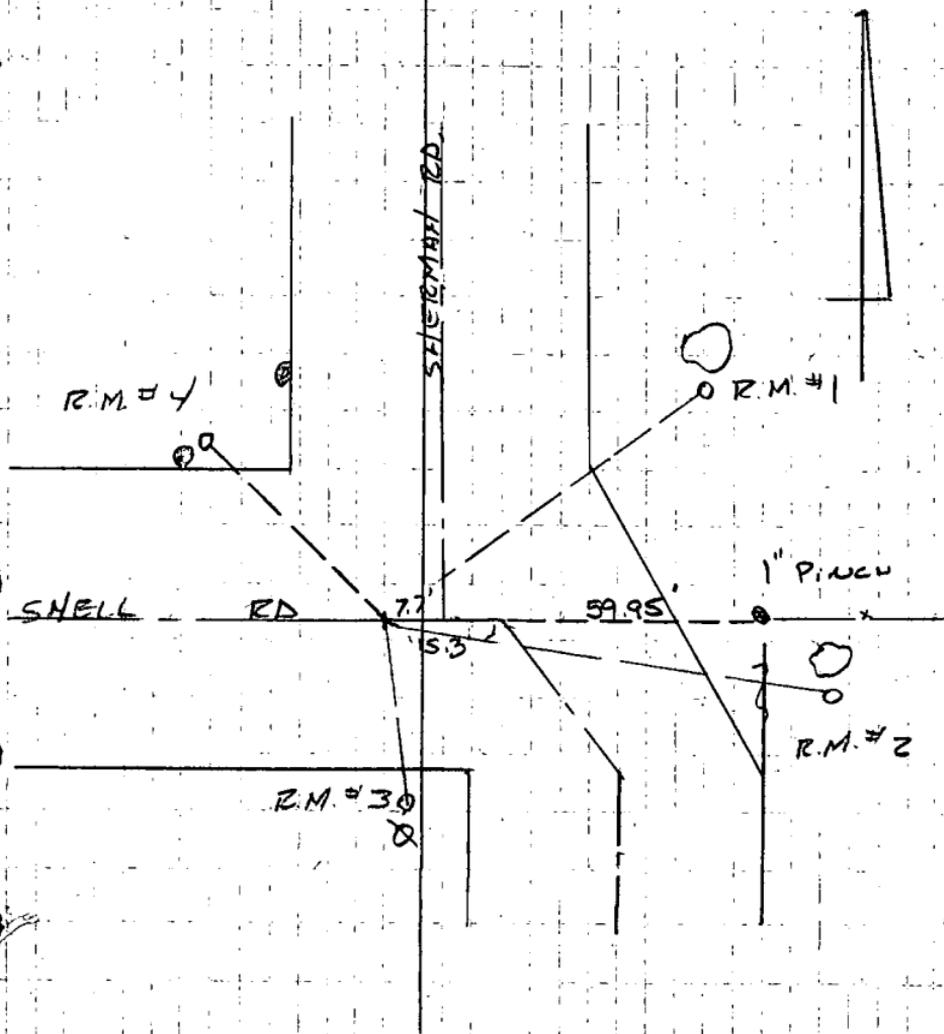

JOB NO.....

DATE.....PAGE 44.....

CORNER No. 13

R.M.#1, 1'± S. OF 24" BOX ELDER TREE = 63.05'

R.M.#2, 1'± S. OF 14" MAPLE TREE = 48.44'

R.M.#3, 1'± N. OF P.P. # 1816-1E66 = 29.15'  
~~50.5'~~

R.M.#4, 1'± NE OF B/W GUARD POST = 51.52'

PARTY CHIEF.....

WEATHER

JOB NO. .... L.K. & R.O.

DATE Nov, 20, 1979 ..... PAGE 45 .....

Tics To the N.W. Corner Sec. 30, T. 18N, R. 16E

CORNER No. 105

REF. P.K'S

11.78' EAST

11.84' SOUTH

11.34' WEST

(R.M. 4)

(R.M. 3)

S/S POST

S/S POST

1.70'

(R.M. 1)

(R.M. 2)

PARTY CHIEF.....

WEATHER.....

R.M. 1	1.0' ± EAST OF <del>WOOD</del> LAST FENCE POST EAST of FENCE INT.	<u>29.51'</u>
R.M. 2	1.0' ± NORTH OF FIRST METAL FENCE POST EAST of FENCE INT.	<u>56.63'</u>
R.M. 3	1.0' ± NORTH OF FIRST FENCE POST WEST OF FENCE INT.	<u>27.91'</u>
R.M. 4	3.0' ± EAST OF SECOND FENCE POST WEST OF FENCE INT.	<u>34.16'</u>
	BK of S/S Post NORTH	<u>33.03'</u>
	BK of S/S Post SOUTH	<u>33.34'</u>
<u>CORNER No. 105</u>		

Ties To the NE COR. Sec. 30, T.18N, R.16E.  
CORNER No. 107

N, REF. P.K.'S

10.32' W,  
8.31' N,  
7.88' S,  
13.93' E

CARVILLE  
RD.

S/S Post  
△ (R.M. 1)

9TH STR. ROAD

28.5'

0.70'

(R.M. 2)  
△

S/S Post  
△

S/S Post  
△ (R.M. 2)

CARVILLE  
RD.

S/S POST FND.  
PER. STATE HWY DEPT  
ALL FIT WITHIN  
0.10'±, THEY ARE  
ALL SLIGHTLY BENT.

JOB NO.....

DATE..... PAGE 48.....

R.M. 1	1.0' ± west of No. 48 / 2901	ANCHOR Pole	<u>36.54'</u>
R.M. 2	1.0' ± west of	P.P. No. 47	<u>38.38'</u>
R.M. 3	1.0' ± east of	P.P. # 48	<u>50.73</u>
R.M. 4	1.0' ± S.E. of	ANCHOR Pole # 1816-30F13	<u>68.92'</u>
<u>CORNER NO 107</u>			

PARTY CHIEF.....

WEATHER.....

TIES TO THE NE CORNER Sec 29  
CORNER No. 109

N.



ORRUBOD ROAD

REF. P.K.'S


8.15' EAST

9.54' SOUTH

P.K. IN W/FACE  
OF P.P. 42.14

(R.M. 1)

TOP E. BK. OF 5/8 POST.  
46.64'



(R.M. 4)

WEST 9TH

STREET ROAD

(R.M. 3)  
SIGN

TOP E. BK. OF 5/8 POST.  
46.91'


(R.M. 2)

P.K. NAIL IN  
TOP OF CULVERT 30.15

P.K. IN WEST  
FACE OF P.P.  
46.23'

R.m. 1	5'± NORTH OF Powerpole	<u>46.73</u>
R.m. 2	10'± SOUTH OF Powerpole	<u>56.20'</u>
R.m. 3	1.0'± WEST OF STR. SIGN POOL	<u>39.28'</u>
R.m. 4	1.0'± SOUTH OF BUSH	<u>35.38'</u>
<u>CORNER No. 109</u>		

Ties To the N<sup>1</sup>/<sub>4</sub> CORNER Sec. 28,  
T.18N., R.16E. CORNER No. 110




DRIVE

REF. P.K.'S  
10.79' SOUTH  
12.53' EAST

9TH AVE.

9TH

(R.M. 2)

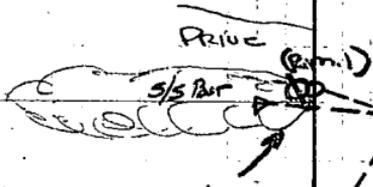

DRIVE

(R.M. 3)

P.K. IN W. FACE  
P.P. 23.45'

SENS. WALK.

WEST

R.M. 1	1.0'± SOUTH of Powerpole	<u>22.36'</u>
R.M. 2	10'± EAST of EAST EDGE of Drive TO 2445 9TH ; <sup>AT</sup> NORTH EDGE of WALK	<u>44.75'</u>
R.M. 3	5'± WEST of WEST EDGE of DRIVE TO 2445 9TH ; AT NORTH EDGE of WALK	<u>34.66'</u>
R.M. 4	1.0' EAST of Powerpole WITH TRANSFORMER.	<del>32.87'</del> <u>85.96'</u>
	<del>TOP of BK of S/S Post NORTH</del> 1" PINCH I.P. W/ E.D.S.C. of S/S Post	<u>32.87'</u>
	CORNER No 110	

JOB NO. L.K.É.R.D.

DATE Nov. 20, 1979 PAGE 53

Ties To the <sup>W 1/4</sup> ~~E 1/4~~ CORNER Sec. 21,  
T. 18 N., R. 16 E. CORNER No. 96

Ref. P.K.'s  
11.06' west  
11.61' SOUTH

SCHOOL  
(R.M. 4)  
52.01 Rec,  
52.22'm.

(R.M. 1)

STATE TIE

STATE TIE 59.28'm  
59.68 Rec.

Town Hall  
Building  
Parcel (R.M. 3)


OAKWOOD

R.M. 1	5'± NORTH OF Powerpole 1816-21 W11		<u>63.81</u>
R.M. 2	5'± SOUTH OF Powerpole No. 1816-2115		<u>64.20</u>
R.M. 3	AT NE. CORNER OF PORCH TO TOWN HALL.		<u>79.45'</u>
R.M. 4	10'± NORTH OF FENCE COR. E 1.0'± EAST OF FENCE		<u>64.07'</u>
Corner No. 96			

JOB NO. .... L.K. F.R.D

DATE .... Nov. 20, 1979 ..... PAGE 55

TIES TO THE NE CORNER OF SEC 20,  
T. 18N., R. 16E. CORNER NO. 83

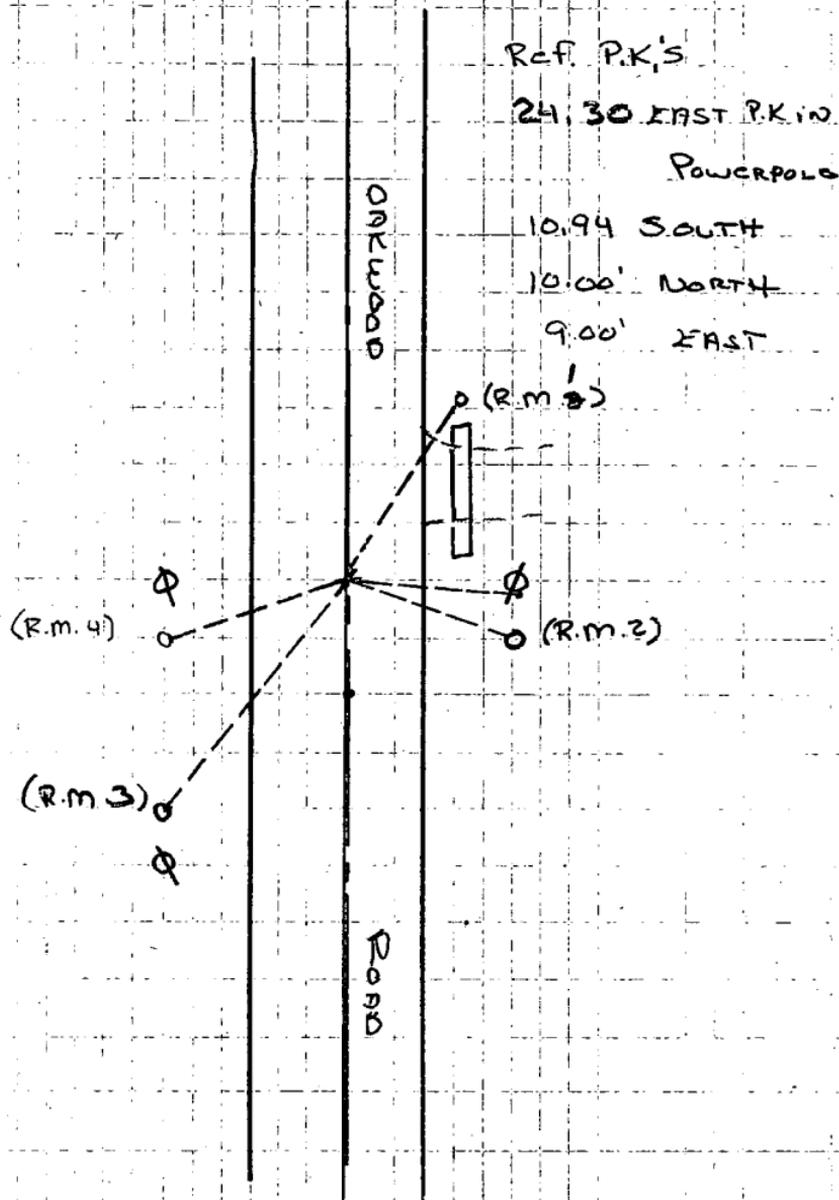

PARTY CHIEF.....

WEATHER.....

JOB NO.....


DATE.....PAGE...56.....

R.M. 1	1.0' ±	NORTH of	NORTH END of	
		METAL	CULVERT.	33.23'
R.M. 2	2.0' ±	SOUTH of	Powerpole	
		No. 1816-16233		24.39'
R.M. 3	2.0' ±	NORTH of	Powerpole	
		No. L610/12		67.07'
R.M. 4	2.0' ±	SOUTH of	Powerpole	
		No 1816-17R1		19.38'
Corner No. 83				

PARTY CHIEF.....

WEATHER

Ties To the Center of Sec. 7  
T. 18 N., R. 16 E. CORNER No 41

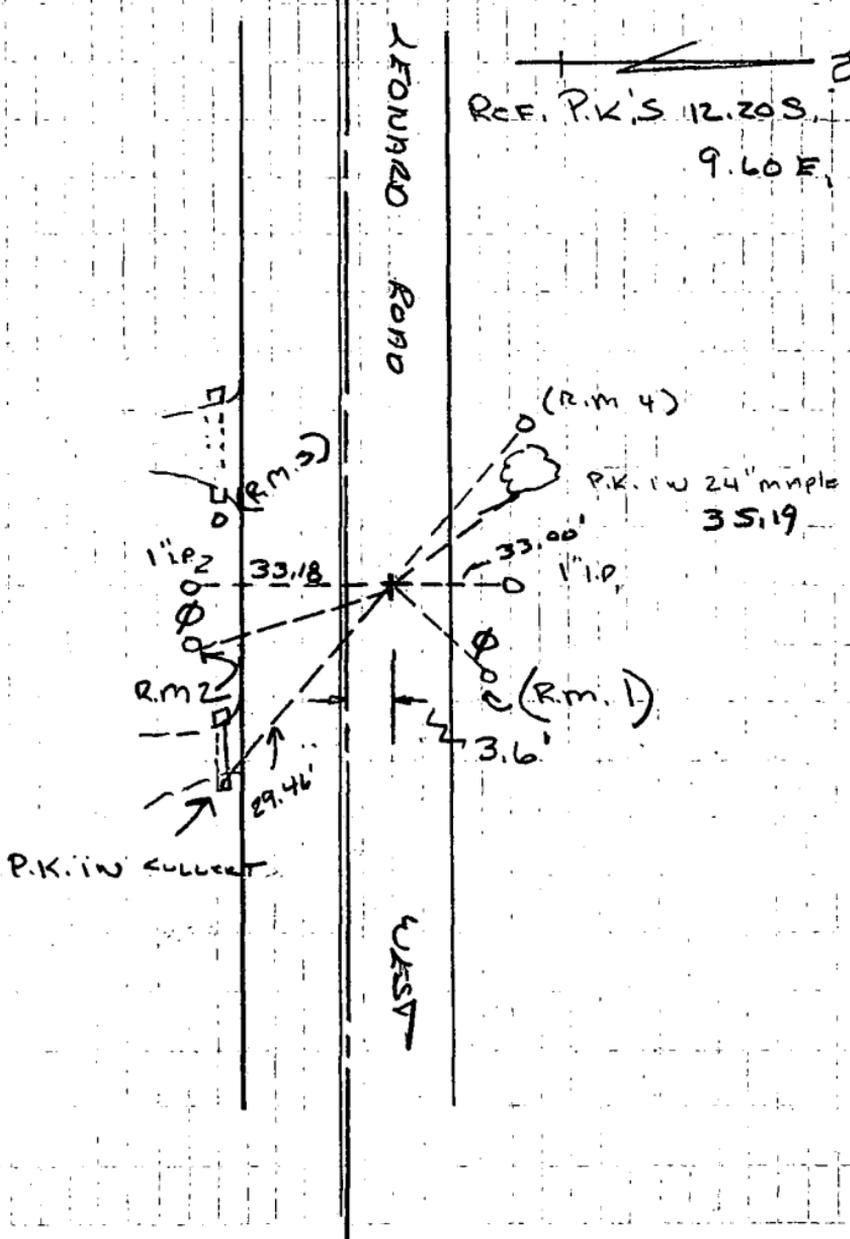

R.M. 1	1.0' ± EAST of No. 1816-7E10	Powerpole <u>20.85'</u>
R.M. 2	1.0' ± EAST of No. 47	Powerpole <u>32.79'</u>
R.M. 3	1.0' ± EAST of EAST END of CULVERT UNDER F.F. Percy's Drive	<u>33.59'</u>
R.M. 4	<del>1.0' ±</del> 2' ± Southwest maple Tree	of 24" <u>35.54'</u>

CORNER No. 41

Ties To the S.W. CORNER Sec 35  
T.18N, R.16E, CORNER No. 165



- Ref. P.K.'S
- 3,48' NE.
- 3,45' SE.
- 3,79' S.W.
- 3,83' NW.

KADDO

(R.M. 1)

P.K. IN SE. FACE

WAWKAU

1.5'

67.65'

Ave

(R.M. 3)

(R.M. 2)

Street

JOB NO.....


DATE.....PAGE.....60.....

R.M. 1	1.0'± west of Powerpole No. 3098	Powerpole	<u>49.83'</u>
R.M. 2	1.0'± South of Powerpole No. 1716-2W27	Powerpole	<u>45.69'</u>
R.M. 3	2.0'± west of Powerpole No. 1716-3E1	Powerpole	<u>39.35'</u>
R.M. 4	1.0'± NE of 20" Hickory Tree	Hickory Tree	<u>37.03'</u>
Corner No. 165			

PARTY CHIEF.....

WEATHER

TIES TO THE E 1/4 COR. SEC. 16, T. 13N,  
R. 16E; COR. 110.72

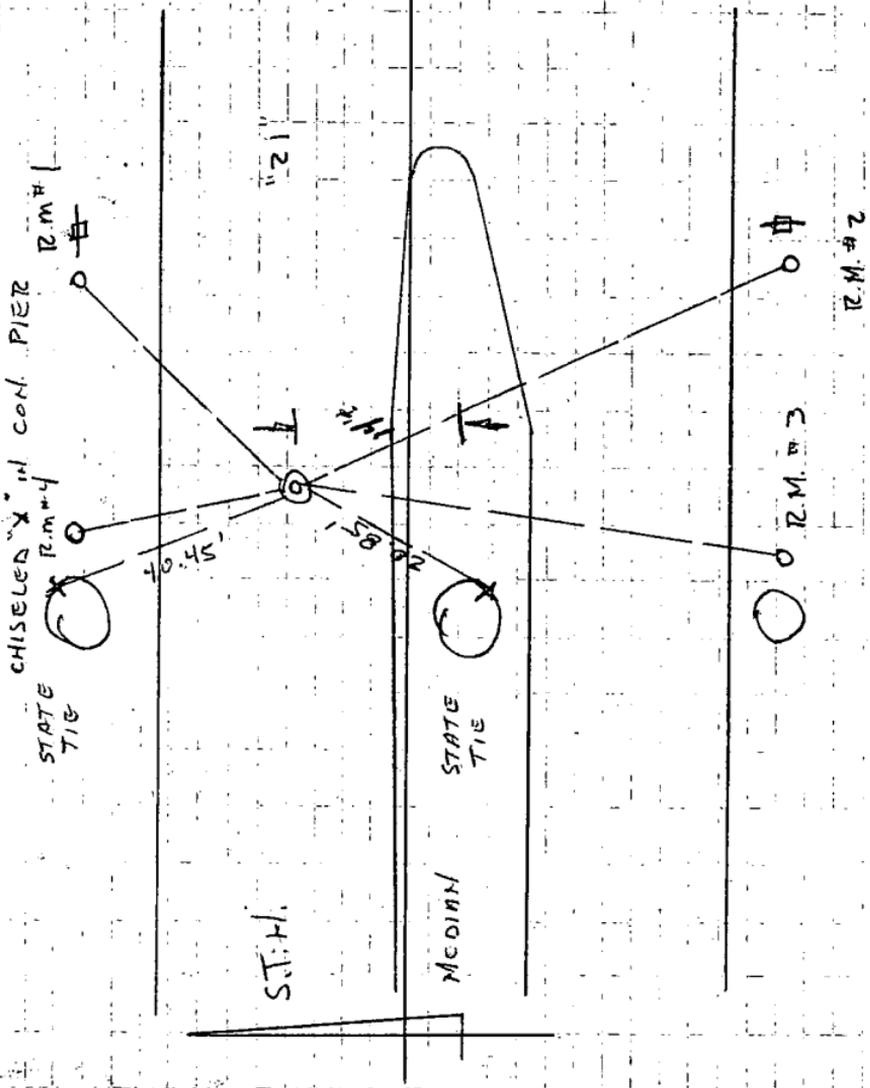

R.M. #1 - 3'± WEST OF ONE WAY RD.  
SIGN = 68.93'

R.M. #2 - 3'± WEST OF NO RIGHT TURN  
RD. SIGN = 78.62'

R.M. #3 - 3'± EAST OF SE. MOST  
CONC. PIER = 64.88'

R.M. #4 - 3'± EAST OF NE MOST  
CONC. PIER = 38.99'


CORNER No 72

---

PARTY CHIEF.....

WEATHER.....

TIES TO CENTER OF SEC 16, T. 18N,  
R. 11E, CORNER No. 71

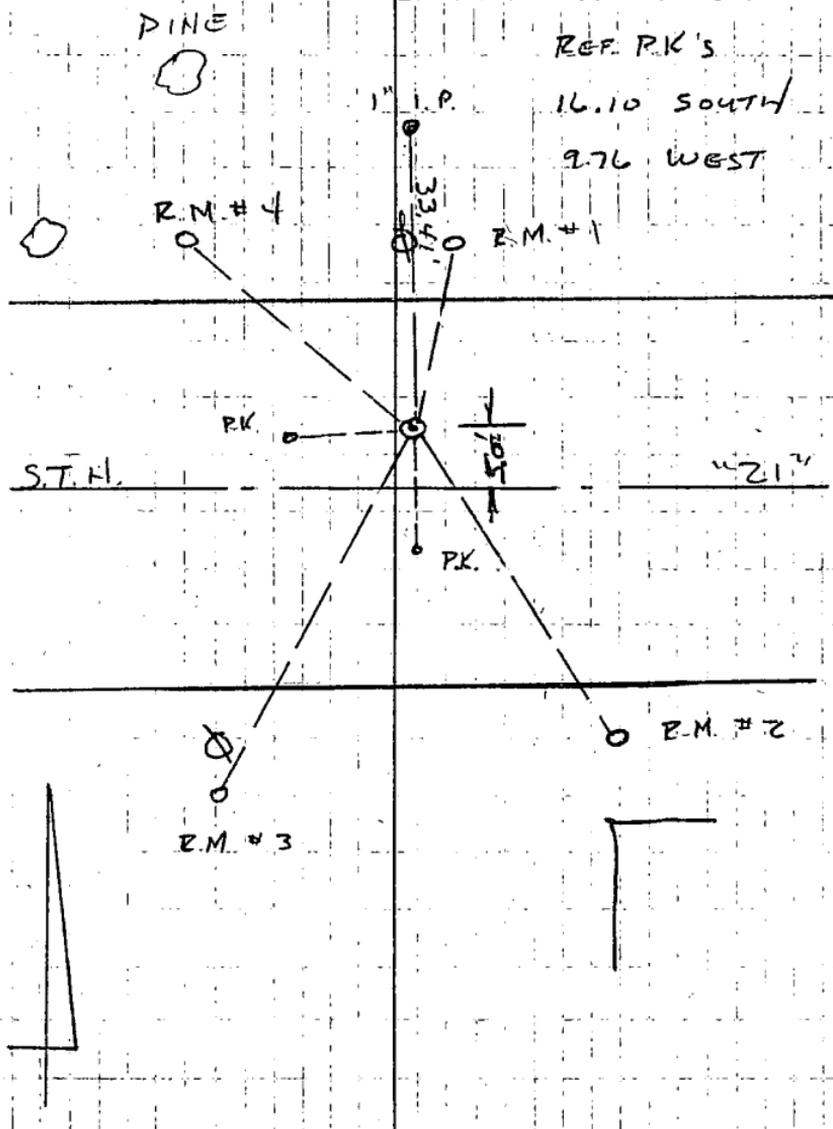

R.M.#1 -  $3\frac{1}{2}$  EAST OF P.P.# 1816-16W 33  
= 21.90'

R.M.#2 - TOP OF S. BANK ON LINE WITH  
 W. FACE OF HOUSE = 36.69'

R.M.#3 -  $3\frac{1}{2}$  SOUTH OF P.P.# 54 = 41.52'

R.M.#4 - DUE SOUTH OF PINE TREE ON  
 P.P. LINE = 55.62'

CORNER No. 71



JOB NO.....

DATE.....PAGE.....66.....

R.M. #1	-	O.N. P.P. LINE	OPP. E. FACE - HOUSE =		
				<u>50.89'</u>	
R.M. #2	-	3'± NORTH OF W. END	WOOD FENCE =		
				<u>59.74'</u>	
R.M. #3	-	3'± <sup>E.</sup> <del>W.</del>	OF P.P. # 1816-1713 =		<u>73.22'</u>
R.M. #4	-	3'± EAST OF P.P. # 89 =			<u>29.05'</u>
		CORNER No.	69		

PARTY CHIEF.....

WEATHER.....



JOB NO.....

DATE.....PAGE.....68

R.M.#1 - 1'± W. OF ST. SIGN. = 50.82'

R.M.#2 - 1'± W. OF WOOD FENCE POST = 41.13'

R.M.#3 - 1'± W. OF P.P. #1816-1821 = 26.97'

R.M.#4 - 1'± E. OF R.P. #108/4600 = 43.90'

CORNER No. 68


PARTY CHIEF.....

WEATHER.....

Ties To the EAST 1/4 corner Sec. 33,  
T. 19 N., R. 16 W. CORNER No. 150

Ref. P.K. NAILS

~~9.00'~~  
~~10.00'~~ NORTH  
~~10.00'~~  
~~10.00'~~ EAST

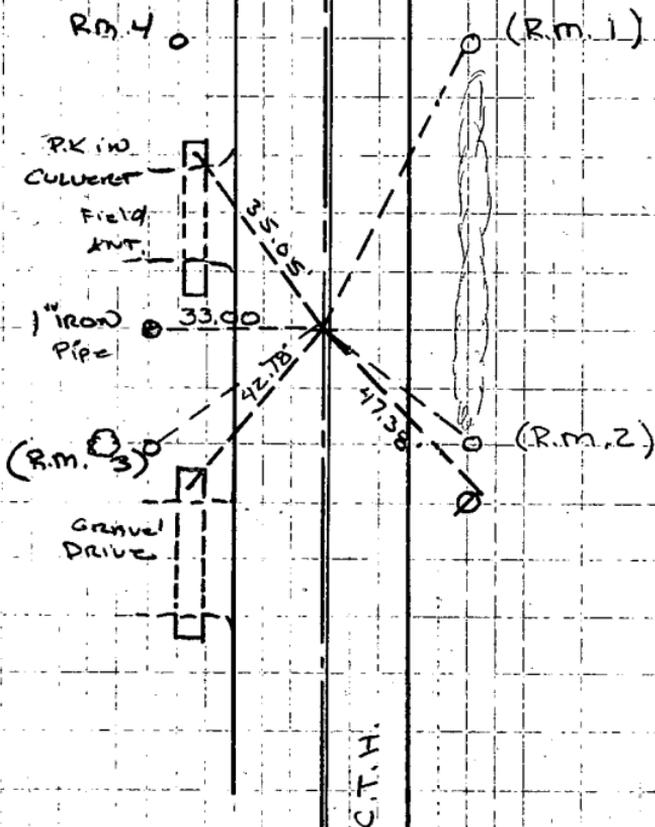

N



JOB NO.....


DATE.....PAGE 70.....

R.M. 1	5' ± NORTH OF NORTHEAST END OF SMALL TREES AND BRUSH.		77.06
R.M. 2	5' ± NORTH OF POWER POLE.		43.37'
R.M. 3	5' ± EAST OF SMALL FRUIT TREE		44.06'
R.M. 4	10' ± NORTH OF NORTHEAST END OF CULVERT E <sup>ST</sup> ON WEST BANK OF DRAINAGE DITCH		45.35'
<u>CORNER NO. 150</u>			

PARTY CHIEF.....


WEATHER.....

Tics To the S 1/4 CORNER Sec. 34,  
T. 19N., R. 16E. CORNER No. 164

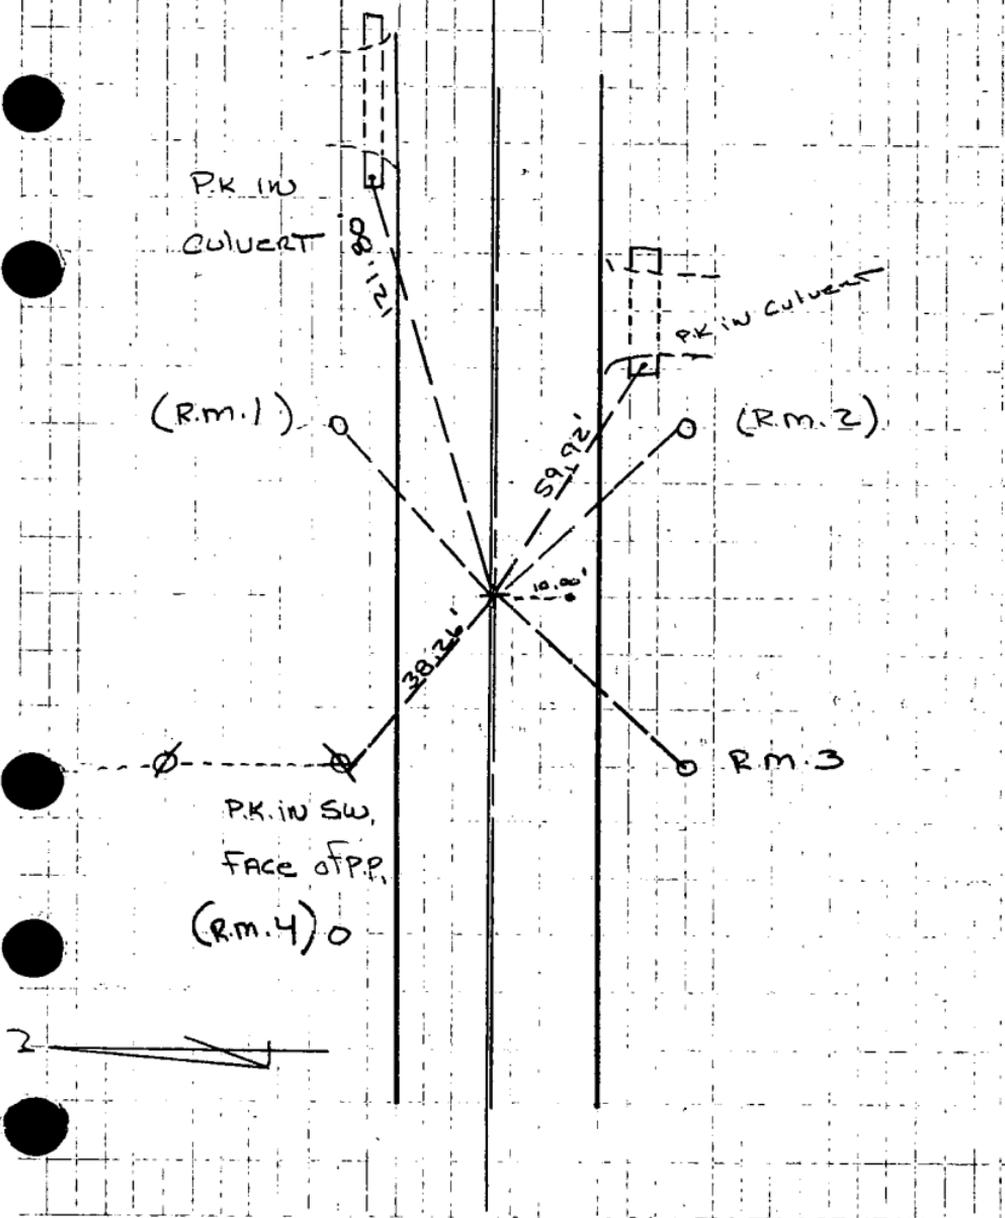

R.M. 1	38'± EAST of Powerpole E			
	30'± <del>S</del> NORTH of Assumed E			
				<u>36.47'</u>
R.M. 2	30'± SOUTH of Assumed E			E
	OPP. (R.M. 1)			
				<u>37.56'</u>
R.M. 3	30'± SOUTH of Assumed E			E
	ON POWERLINE EXT SOUTH			
				<u>37.58'</u>
R.M. 4	10'± WEST of Powerpole			
				<u>44.03'</u>
	<u>CORNER No 164</u>			

Tics To the S<sup>1</sup>/<sub>4</sub> CORNER of Sec. 26, T. 18N, R. 6E  
Corner No. 140

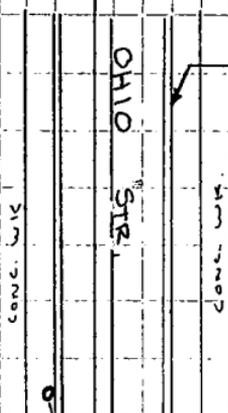

6" CURB  
REF. P.K. NAILS  
6.19' NORTH  
7.00' WEST

R.M. 1

WEST 20TH

STR.

(R.M. 2)

(R.M. 3)

6" CURB

WITTMAN  
Field

PARTY CHIEF..... LARRY KRIESCHER.....

WEATHER..... CLOUDY 41°.....

JOB NO.....

DATE.....PAGE 74.....

R.M. 1 1'± NW. of Powerpole #  
7.5'± west of BK. wk.  
33.51'

R.M. 2 1'± west of Powerpole  
32.44'

R.M. 3 1'± NORTH OF METAL LIGHT pole  
81.40'

R.M. 4 5'± NORTH of END of CURB #  
0.4'± west of BK. of CURB  
39.90'


CORNER No 140

PARTY CHIEF.....

WEATHER.....

TIES To the SE CORNER Sec 27, T.18N. R.16E.  
Corner No. 139

REF. PK NAILS  
24.63' NORTH  
17.01' EAST

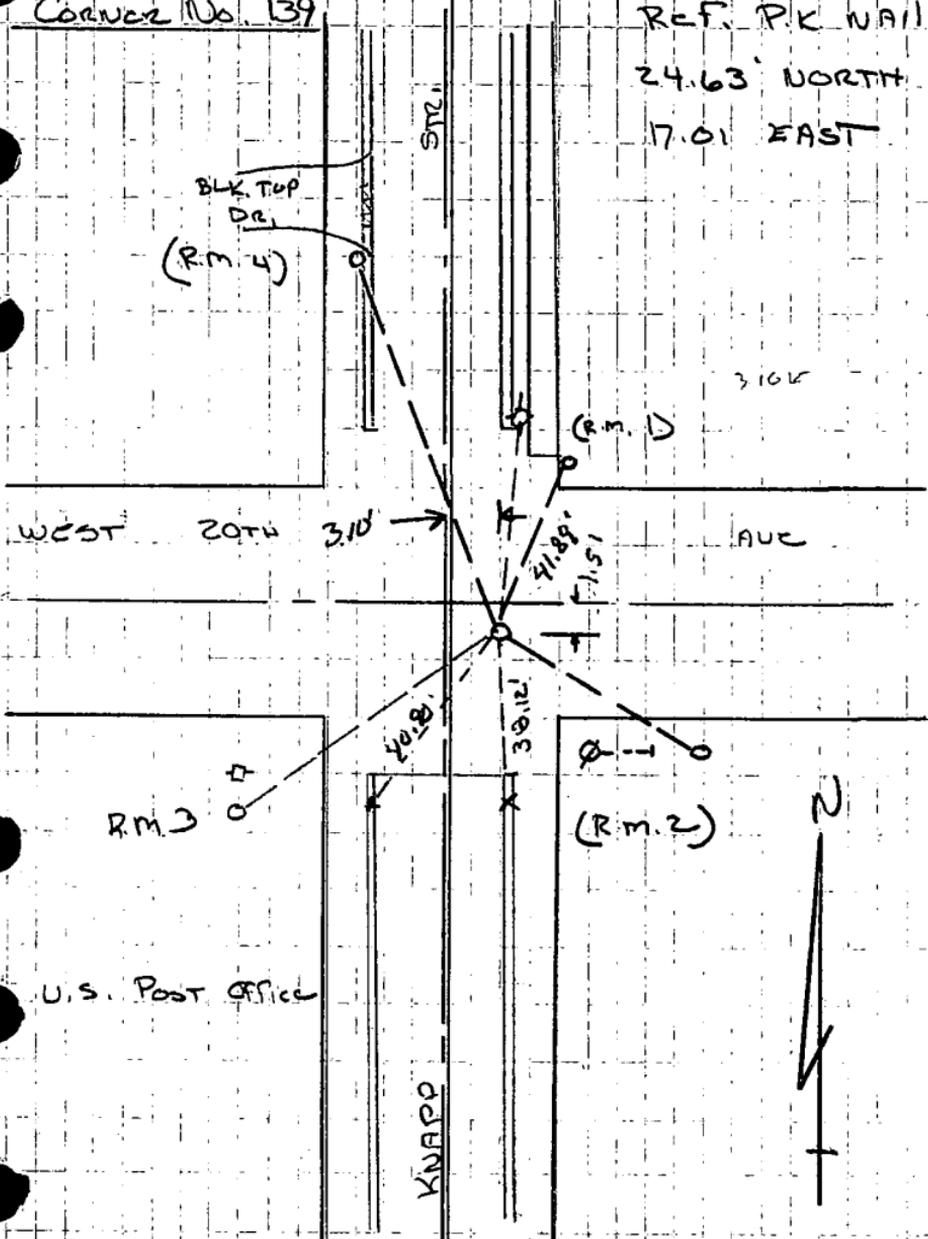


R.M. 1	0.5'± EAST of BK. WK. E SOUTH END of WK.	AT <u>39.52'</u>
R.M. 2	S'± EAST of Guy wire	<u>55.79'</u>
R.M. 3	1.5'± SOUTH of Post Office ENT. SIGN.	<u>48.54'</u>
R.M. 4	S'± SOUTH of S/KDGE of BLK. TOP DRIVE E 0.5'± West of BK CURB	<u>72.84'</u>
<u>CORNER No. 139</u>		

Ties To the S <sup>1</sup>/<sub>4</sub> Corner Sec. 27,  
T.18N, R.16E, Corner No. 138

REF. P.K. NAILS

12.03 NORTH

8.34 WEST

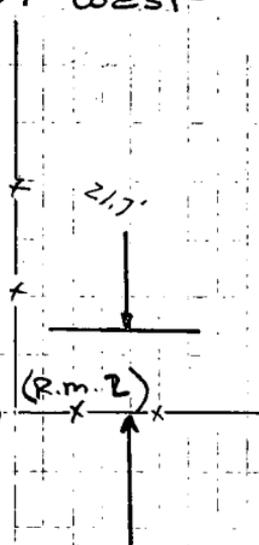

AVE

WEST

WEST

(R.m. 1)



R.m. 4



54.4'

(R.m. 3)



P.K. 10 N.W. FACE  
OF P.P. # 1816-34664

2





Ties To the NE COR Sec 33

TIBN, RIGK  
Corner No. 137

HARRISON Mon.

SOUTH BOUND LANE

U.S.H. '41"

FRONTING ROAD

Corner of Stone Wall

(Cemetery)

Stone wall

(P.M. 2)

(P.M. 3)

(P.M. 4)

O.T. 14

K  
19.11'

Damage Gas Pipe

29.55'

RK 10.70'

(P.M. 1)

42.70'

JOB NO.....

DATE..... PAGE 80.....

R.M. 1	1.0'± west of wooden Fence Post		<u>10.10'</u>
R.M. 2	0.5'± EAST of SE. CORNER of Stone Wall		<u>52.47'</u>
R.M. 3	0.5'± NORTH of NW. CORNER of Stone Wall		<u>52.09'</u>
R.M. 4	25'± NORTH of E of Frontage Road opp. WEST END of Stone Wall		<u>46.46'</u>
<u>CORNER No. 137</u>			

PARTY CHIEF.....

WEATHER.....